

MAS004396_A RU 24-38

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



Maserati

PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 754

M189 GT GC - ECM Software Update



ATTENTION! This bulletin supersedes MAS004396 RU 23-31 released on Sept 30, 2024. Please discard/remove all copies of the previous bulletin.

DATE: October 29, 2024

Certain Maserati GranTurismo (M189) and GranCabrio (M190) MY24 listed in MODISCS+ are involved in a Rapid Update to update the ECM (Engine Control Module) software.

This action is necessary to enhance the operational strategy of the air shutter grid (AGS). In certain conditions, the engine coolant temperature may rise, prompting the ECM to limit engine performance to prevent overheating and potential component damage.

Note: The vehicle remains maneuverable under these conditions.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before ordering parts and/or starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions.

Thank You for your continued support and cooperation.

Maserati North America
Aftersales Dept.

Technical Procedure



All images shown in this bulletin are for illustrative purposes only.

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Before proceeding, please ensure that the Engine is OFF.
3. Connect a battery maintainer to the 12V battery (It is recommended to always use the E-XTEQ MAXIMUS to maintain minimum voltage and current draw requirements)
4. Connect the EVO to the vehicle, ensure that battery voltage is around 12.5V then select **ECM**
▶ **ECU Programming** and follow the prompts.

Software version to be installed (or newer).

Region	Engine	F188 Target
NAFTA	490hp	670353754
	550hp	670353753

5. Perform **BCM – Procedures – PROXI Alignment**.
6. After the update has been successfully completed. Clear any residual DTCs.
7. Procedure complete.

Warranty Claim

Fill in the Warranty Claims as follows:

Description	Code
Rapid Update Number	754
Warranty Code	23
Fault Code	063
Component Code	1.90.001
Operation Code	1.90.001.A (0,20h)