

MAS004413 RU 24-37

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



Maserati

PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 751 Grecale BEV – OBCM Software Update

TECHNICAL SERVICE OPERATIONS



DATE: OCTOBER 17, 2024

Certain Maserati GranTurismo (M189) Grecale (M182) BEV MY25 listed in MODISCS+ are involved in a Rapid Update to update the OBCM (On-Board Charger Control Module) software.

A limited number of vehicles require the OBCM module to be updated to resolve a potential issue that may cause a malfunction in the charging system, which can only be temporarily resolved by unplugging and re-plugging the charger.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before ordering parts and/or starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions.

Thank You for your continued support and cooperation.

Maserati North America
Aftersales Dept.

Technical Procedure



All images shown in this bulletin are for illustrative purposes only

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Before proceeding, please ensure that the Engine is OFF.
3. Connect a battery maintainer to the 12V battery (It is recommended to always use the E-XTEQ MAXIMUS to maintain minimum voltage and current draw requirements)
4. Connect the EVO to the vehicle, ensure that battery voltage is around 12.5V then select **OBCM ► ECU Programming** and follow the prompts.

IMPORTANT! Please carefully follow the instructions given during this process. (Example: request to switch the **ignition OFF**)

Software version to be installed (or newer).

Market	F188 Target
ROW	670353732

5. After ECU programming, perform **BCM – Procedures – PROXI Alignment**.
6. **After the ECUs updates, please follow the following operations:**
 - **Disconnect the 12V Battery Maintainer from the 12V Battery**
 - **Disconnect the MDVCI2**
 - **Perform the Key OFF**
 - **Wait for the power latch (wait until the dashboard clock turns off)**
 - **Reconnect the 12V Battery Maintainer to the 12V Battery**
 - **Perform the Key ON**
 - **Reconnect the MDVCI2, restart the MDEVO application and clear DTCs from the ECU View**
 - **Perform the Ignition Cycle (Key OFF and Key ON)**
7. Procedure complete.

Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Rapid Update Number	751
Warranty Code	23
Fault Code	063
Component Code	8.22.002
Operation Code	8.22.002.A (0,20 h)