



SSM 53094 2024 Bronco - 2.3L - Intermittent Illuminated Brake Warning Lamp With DTC P050F In The ABS Module

Some 2024 Bronco vehicles equipped with the 2.3L engine may exhibit a red brake warning lamp and brake system warning message in the instrument panel cluster (IPC) with a diagnostic trouble code (DTC) P050F in the anti-lock brake system (ABS) module. This may be accompanied by an intermittent firm brake pedal after driving for long periods at highway speeds. This may be due to improper sealing of an internal diaphragm within a brake booster vacuum line. To correct this condition, replace the vehicle's vacuum line with the latest version, service part number MB3Z-2420-K or later. For claiming, use casual part 2420 and claim M-time.