

 Preview Solution CBR-2406-2

Volvo VN Chassis - Headlight High Beams Do Not Function From Stalk Switch

Published 8 October 2024

Valid For

VNL,VNR,VNX model year 2020 to 2025

Solution

For Volvo VN Chassis model year 2020 to 2025 (build date 2019 to 2024), the headlamp high beams may be found to function when the pre-trip function is engaged, but do not function when high beams are selected from the stalk switch.

This condition may occur when a standard headlamp is changed to a premium headlamp or when a premium is changed to a standard. Software changes are required if this replacement has occurred.

If the symptoms above are encountered on an applicable vehicle:

1. Using Premium Tech Tool (PTT), run Accessory Kit 85171105.
2. Cycle the key switch to OFF for 10 seconds, then back to ON.
3. Check for proper high beam operation using the stalk switch.

IF THE HIGH BEAMS REMAIN INOPERATIVE from the stalk switch after running the accessory kit:

4. Re-run accessory kit 85171105.
5. Cycle the key switch to OFF for 10 seconds, then back to ON.
6. Proceed with diagnosis as normal.

Related links and attachments

No links or attachments available



Share

to others that might find it helpful



Feedback

[Give feedback](#)

to help improve the content of this article