NON-COMPLIANCE RECALL



Volvo Trucks North America

Greensboro, NC USA

Date Number Release Page 10.2024 **EC0029 01 1(6)**

Incorrect Engine Power Ratings VAH, VHD, VN

RECALL INFORMATION

(October 2024)

Volvo Trucks has determined that certain vehicles equipped with a model year ("MY") 2022-2024 13L engines, may be equipped with an improper engine software calibration that does not match the engine certification label.

To ensure Volvo vehicles stay emission compliant follow the repair instructions outlined in this document to Program the EECU and install a completion label in the door.

VEHICLES AFFECTED


Certain Volvo vehicles manufactured between June 8, 2021, and December 22, 2023.

VEHICLE QUANTITY

There are 1,169 vehicles affected by this recall (1.095 U.S., 74 Canada)

Repair Instructions

- 1. Park the vehicle on a level surface.
- 2. Apply the parking brake.
- 3. Place the gear lever in neutral.
- 4. Install wheel chocks.

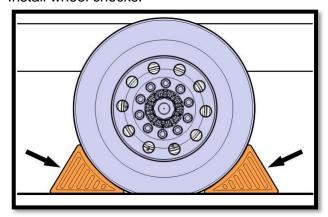

- 5. Connect the latest version of Premium Tech Tool (PTT) to the Vehicle.
- 6. After identification is complete, navigate to the program tab within PTT.
- 7. Program the Engine Control Module and Aftertreatment Control Module using operation 1700-08-03-39 under the Program tab.

Important Note!


If no software is available for the ECM/ACM, then the truck already had the most upto-date SW installed. Fill out and install the completion label.

- 8. After programming is complete, clear any DTC's caused by programming.
- 9. Install and fill out the Campaign Completion Label if needed.


Label & Certificate Instructions

NOTE

A campaign completion label (part number 85152363) needs to be installed on truck if not previously installed. To signify the campaign has been completed, use a permanent marker (Such as a Sharpe ®) to write the recall number, completion date (MM/DD/YYY) and dealer code on the label. The label is to be applied to the inside of the passenger door as shown in the illustrations below.

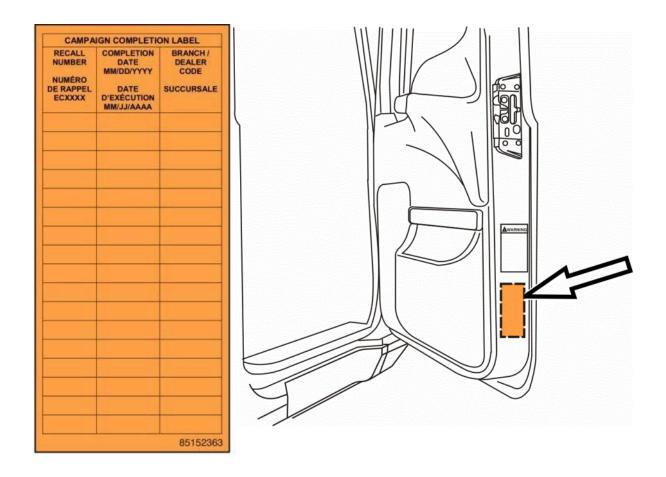

10. Remove the wheel chocks.

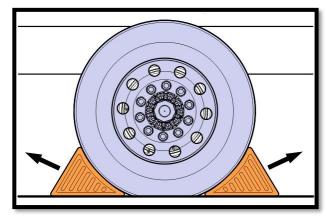

11. Release the vehicle to the customer.

Important Note!

If needed, print out this Emission Recall Proof of Correction Certificate. Fill in the appropriate information for your records and provide a copy to the customer.

Vehicle Emissions Recall - Proof of Correction						
License Number	Make	Year Model	Year Model	Vehicle Identification Number		
Manufacturer: Recall Number:						
The above described vehicle has been repaired, modified to address the Emissions Related Recall that is listed above.						
Dealer's	ſ	Address	, City, State			
Dealer's Authorized Signature						
X						
Return this certificate to DMV only when required - otherwise retain for your records.						

REIMBURSEMENT

This repair is covered by an authorized Non-Compliance recall. Reimbursement is obtained through the normal claim handling process.					
	UCHP Reimbursement				
Claim Type (used only when uploading from the Dealer Business System)	40				
Recall Status					
Vehicle repaired per instructions	1-Modified per instructions				
Labor code option 1 (Only)					
2841-22-02-01 ECM and ACM, Reprogramming	0.4				
Causal Part	85101286				
Authorization Number	M0295				

Note: Dealers are to perform Non-Compliance Recall on all subject vehicles at no charge to the vehicle owner regardless of mileage, age of vehicle or ownership (original purchaser or subsequent purchasers). Whenever vehicles are subject to a Non-Compliance Recall are brought to your dealership for service, or taken into your dealership vehicle inventory, it is strongly recommended that every effort be made to perform the recall correction before the vehicle is sold or released to the owner.