

V O L V O

Volvo Car USA LLC

Technical Journal

Technical Journal Title White patch condition in paint from protection cover		Ref. No. TJ 36277.2.1	
Issuer (Dept.) Technical Service		Issue Date 10/22/24	Status Date 10/24/24
Car Market United States and Canada	Partner 3 US 7510 Volvo Car USA	Function Group 8000	
Function Description Body, cab and interior		Page Page 1 of 3	

Attachment

File Name	File Size
TJ-36277.pdf	0.0776 MB

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

DESCRIPTION:

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

* If experiencing milky stripes/white patch conditions in the paint when the raggard or vehicle cover is removed, please see advice under "Service".

CSC Customer Symptom Codes

Code	Description
O8	Body parts, paint finish (not including trim)/Stained/spotted paint
O9	Body parts, paint finish (not including trim)/Faded/dull paint
L3	Body parts, sheet metal/Other body panel problems (not including trim)

DTC Diagnostic Trouble Codes

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
224							2019-9999		0000001-9999999	201835-209952
225							2019-9999		0000001-9999999	201817-209952
227							2019-9999		0000001-9999999	201846-209952
234							2017-2017		0000001-9999999	201617-209952
235							2017-9999		0000001-9999999	201624-209952
236							2017-9999		0000001-9999999	201646-209952
238							2017-9999		0000001-9999999	201646-209952
246							2018-9999		0000001-9999999	201717-209952
256							2016-9999		0000001-9999999	201505-209952

Technical Journal 36277.2.1

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
416							2024-9999		0000001-9999999	202336-209952
536							2019-9999		0000001-9999999	201746-209952
539							2022-9999		0000001-9999999	202139-209952

SERVICE:

* If milky stripes/white patch condition occur when the rapgard or vehicle cover is removed, do NOT polish, wax or repaint the area. The defect can be removed by exposure to outside daylight for 48hrs. Or an IR-radiator can be used, carefully heat up the area to a temperature of 50-70°C (122-158°F) for 30 minutes. Note! The temperature of paintwork must not exceed 100°C (212°F). For example pictures of the defect, see attachment TJ-36277.pdf.

To prevent these defects from occurring, please follow the instruction of how to remove the rapgard in a correct way. Instruction to be found in VIDA with below address:

Information > Repair > General Information > 8. Body and interior > 80 General > 801 Surface treatment material > RAPGARD-F paintwork protection

Warranty claim info:

No warranty claims accepted for this TJ

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 8000.

To view TJ attachments continue to next page. This TJ has one attachment.

TJ-36277

