

WPK9 - Check Crankcase Ventilation Plug Connection (Workshop Campaign)

Model Line: **Panamera (971)
Macan (95B)
Cayenne (9YA / 9YB)**

Model Year: **As of 2017 up to 2023**

Country /
Market: USA (C02)
Canada (C36)

Concerns: **Crankcase ventilation line plug connection**

Cause: **There is a possibility that the plug connection of the crankcase ventilation is not locked correctly on the affected vehicles.**

If this is the case, the tightness of the crankcase ventilation cannot be guaranteed.

Action: Check plug connection for crankcase ventilation and lock correctly if necessary.

Affected Vehicles: Only vehicles assigned to the campaign (see also PCSS Vehicle Information).

Checking crankcase ventilation plug connection - Panamera (971)


Work Procedure:



Information

The dome strut is not removed, it is sufficient to only lift the engine compartment cover. ⇒ *Access point for plug connection for crankcase ventilation*

- 1 Loosen and lift motor cover (design cover).
For procedure, see: ⇒ *Workshop Manual '108319 Removing and installing engine cover (design cover)'*

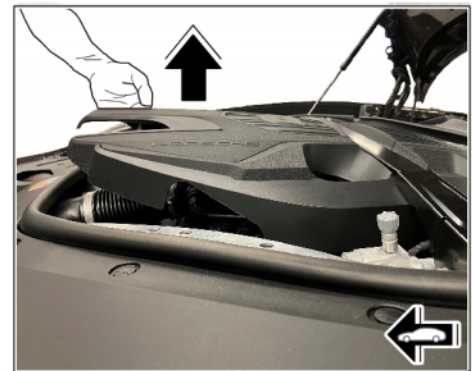

Access point for plug connection for crankcase ventilation


- 2 Check crankcase ventilation plug connection for tightness ⇒ *Plug connection for crankcase ventilation -1-* by countering it and lock it correctly if necessary.
- 3 Fasten engine cover (design cover).
For procedure, see: ⇒ *Workshop Manual '108319 Removing and installing engine cover (design cover)'*
- 4 Attach **Recall Proof of Completion label** to the front lid (**California Porsche Centers only**).

Instructions for attaching labels

- Surfaces on which you intend to attach the label must be clean, dry and free from grease and oil residues.
- Before attaching the label, clean the surfaces using a suitable cleaning agent and a clean, grease-free and lint-free cloth.
- This label must not be affixed over existing label.
- Attach label only at the specified positions.

- 4.1 Fill out the Recall Proof of Completion label ⇒ *Recall Proof of Completion Label* fully and correctly. This includes the recall code "**WPK9**", your Porsche Center code and the repair date.

- 4.2 Clean the surface in the lower area on the front lid at the left-hand side in direction of travel at which the Recall Proof of Completion label must be attached ⇒ *Proof of Completion Label: specified position (Exemplary illustration) -arrow-* using a suitable cleaning agent and a clean, grease-free and lint-free cloth.

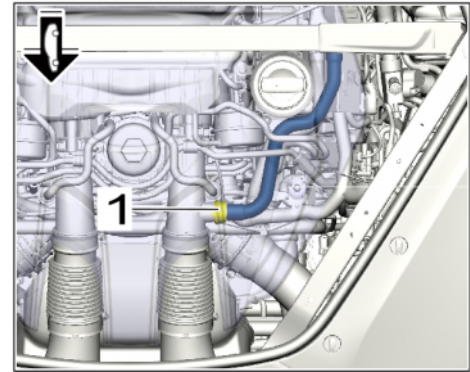

Plug connection for crankcase ventilation

RECALL / CAMPAIGN COMPLETION	
	RECALL CODE
	DEALER CODE
	REPAIR DATE
DO NOT REMOVE	

Recall Proof of Completion Label

- 4.3 Affix Recall Proof of Completion label in the lower area of the front lid at the lefthand side in direction of travel ⇒ *Proof of Completion Label: specified position (Exemplary illustration) -arrow-*.
- 4.4 Close front lid.
- 5 Enter the campaign into the Warranty and Maintenance logbook.




Proof of Completion Label: specified position (Exemplary illustration)

Checking crankcase ventilation plug connection - Cayenne (9YA/ 9YB)

Work Procedure: 1 Remove engine cover (design cover).
 ⇒ *Workshop Manual '108319 Removing and installing engine cover (design cover)'*

- 2 Check crankcase ventilation plug connection for tightness ⇒ *Plug connection for crankcase ventilation -1-* by countering it and lock it correctly if necessary.
- 3 Install engine cover (design cover).
 ⇒ *Workshop Manual '108319 Removing and installing engine cover (design cover)'*
- 4 Attach **Recall Proof of Completion label** to the front lid (**California Porsche Centers only**).

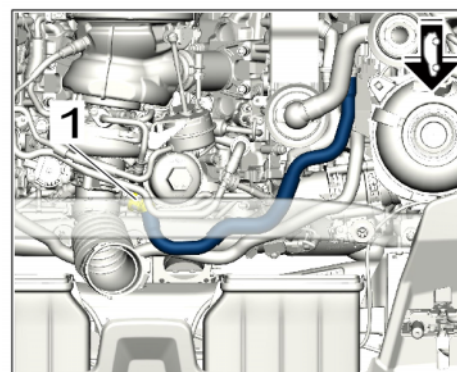

Plug connection for crankcase ventilation

Instructions for attaching labels

- Surfaces on which you intend to attach the label must be clean, dry and free from grease and oil residues.
- Before attaching the label, clean the surfaces using a suitable cleaning agent and a clean, grease-free and lint-free cloth.
- This label must not be affixed over existing label.
- Attach label only at the specified positions.

- 4.1 Fill out the Recall Proof of Completion label
⇒ *Recall Proof of Completion Label* fully and correctly. This includes the recall code "WPK9", your Porsche Center code and the repair date.
- 4.2 Clean the surface in the lower area on the front lid at the left-hand side in direction of travel at which the Recall Proof of Completion label must be attached ⇒ *Proof of Completion Label: specified position (Exemplary illustration) -arrow-* using a suitable cleaning agent and a clean, grease-free and lint-free cloth.
- 4.3 Affix Recall Proof of Completion label in the lower area of the front lid at the lefthand side in direction of travel ⇒ *Proof of Completion Label: specified position (Exemplary illustration) -arrow-*.
- 4.4 Close front lid.
- 5 Enter the campaign into the Warranty and Maintenance logbook.

Recall Proof of Completion Label



Proof of Completion Label: specified position (Exemplary illustration)

Checking crankcase ventilation plug connection - Macan (95B)

- Work Procedure: 1 Remove engine cover (design cover).
⇒ *Workshop Manual '108319 Removing and installing engine cover (design cover)'*

2 Check crankcase ventilation plug connection for tightness ⇒ *Plug connection for crankcase ventilation -1-* by countering it and lock it correctly if necessary.

3 Install engine cover (design cover).
⇒ *Workshop Manual '108319 Removing and installing engine cover (design cover)'*


4 Attach **Recall Proof of Completion label** to the front lid (**California Porsche Centers only**).

Instructions for attaching labels


- Surfaces on which you intend to attach the label must be clean, dry and free from grease and oil residues.
- Before attaching the label, clean the surfaces using a suitable cleaning agent and a clean, grease-free and lint-free cloth.
- This label must not be affixed over existing label.
- Attach label only at the specified positions.

4.1 Fill out the Recall Proof of Completion label
⇒ *Recall Proof of Completion Label* fully and correctly. This includes the recall code "**WPK9**", your Porsche Center code and the repair date.

4.2 Clean the surface in the lower area on the front lid at the left-hand side in direction of travel at which the Recall Proof of Completion label must be attached ⇒ *Proof of Completion Label: specified position (Exemplary illustration) -arrow-* using a suitable cleaning agent and a clean, grease-free and lint-free cloth.

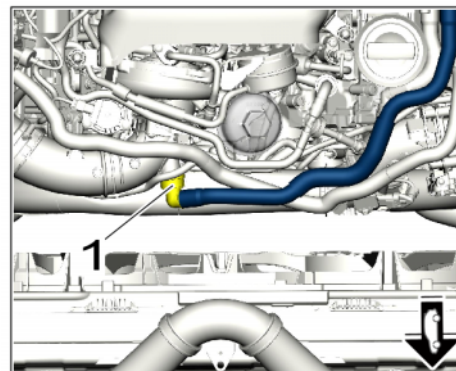

Plug connection for crankcase ventilation

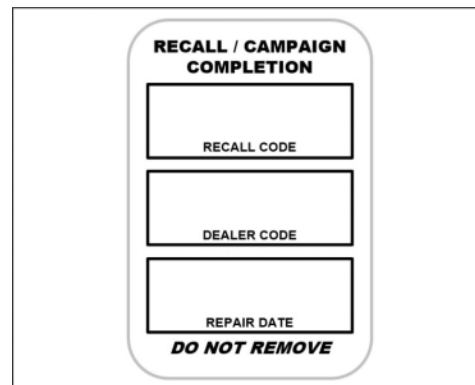

Recall Proof of Completion Label

- 4.3 Affix Recall Proof of Completion label in the lower area of the front lid at the lefthand side in direction of travel ⇒ *Proof of Completion Label: specified position (Exemplary illustration) -arrow-*.
- 4.4 Close front lid.
- 5 Enter the campaign into the Warranty and Maintenance logbook.



Proof of Completion Label: specified position (Exemplary illustration)

Warranty processing



Information

The specified labor times were determined specifically for carrying out this campaign and include all necessary preliminary and subsequent rework. The labor times may differ from the labor times published in the Labor Operation List in PCSS.

Scope 1: **Checking crankcase ventilation plug connection**

- Valid for **Panamera (971)**

Labor time:		
Checking crankcase ventilation plug connection		Labor time: 15 TU
Includes: Loosen and fasten motor cover (design cover)		
Attach Recall Proof of Completion label and provide signed proof of correction to customer (California Porsche Centers only)		
Required parts:		
PNA EMI 000 00	Label – Recall Proof of Completion	1 ea.
PNA 999 100 235	Certificate - Recall Proof of Correction	1 ea.
<p>* California Porsche Centers only:</p> <ul style="list-style-type: none"> • For warranty processing, enter the Part No. PNA EMI 000 00 with the designation "label" as a local part at US\$ 0.34 in the warranty claim. • For warranty processing, enter the Part No. PNA 999 100 235 with the designation "certificate" as a local part at US\$ 0.01 in the warranty claim. <p>⇒ Damage Number WPK9 066000 1</p>		

Warranty processing



Information

The specified labor times were determined specifically for carrying out this campaign and include all necessary preliminary and subsequent rework. The labor times may differ from the labor times published in the Labor Operation List in PCSS.

Scope 1-2: **Not relevant for this vehicle type.**

Scope 3: **Checking crankcase ventilation plug connection**

- Valid for **Cayenne (9YA / 9YB)**

Labor time:		
Checking crankcase ventilation plug connection		Labor time: 16 TU
Includes: Removing and installing engine cover (design cover)		
Attach Recall Proof of Completion label and provide signed proof of correction to customer (California Porsche Centers only)		
Required parts:		
PNA EMI 000 00	Label - Recall Proof of Completion	1 ea.
PNA 999 100 235	Certificate - Recall Proof of Correction	1 ea.
<p>* California Porsche Centers only:</p> <ul style="list-style-type: none"> • For warranty processing, enter the Part No. PNA EMI 000 00 with the designation "label" as a local part at US\$ 0.34 in the warranty claim. • For warranty processing, enter the Part No. PNA 999 100 235 with the designation "certificate" as a local part at US\$ 0.01 in the warranty claim. <p>⇒ Damage Number WPK9 066000 1</p>		

Warranty processing**Information**

The specified labor times were determined specifically for carrying out this campaign and include all necessary preliminary and subsequent rework. The labor times may differ from the labor times published in the Labor Operation List in PCSS.

Scope 1: **Not relevant for this vehicle type.**

Scope 2: **Checking crankcase ventilation plug connection**

- Valid for **Macan (95B)**

Labor time:		
Checking crankcase ventilation plug connection		Labor time: 16 TU
Includes: Removing and installing engine cover (design cover)		
Attach Recall Proof of Completion label and provide signed proof of correction to customer (California Porsche Centers only)		
Required parts:		
PNA EMI 000 00	Label – Recall Proof of Completion	1 ea.
PNA 999 100 235	Certificate - Recall Proof of Correction	1 ea.
<p>* California Porsche Centers only:</p> <ul style="list-style-type: none"> For warranty processing, enter the Part No. PNA EMI 000 00 with the designation "label" as a local part at US\$ 0.34 in the warranty claim. For warranty processing, enter the Part No. PNA 999 100 235 with the designation "certificate" as a local part at US\$ 0.01 in the warranty claim. <p>⇒ Damage Number WPK9 066000 1</p>		

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© 2024 Porsche Cars North America, Inc.