



Service Information

Offboard Diagnostic Information System Service (ODIS Service)

Number: VOS-24-125

Subject: ECM Component Adaptation Test Hotfix Instructions

Date: Oct. 25, 2024

Important:

We recommend installation of this hotfix on one diagnostic device ONLY. Hotfix must be removed immediately after performing the procedure.

1.0 – Introduction

The hotfix is for the **ECM Component Adaption Test after component replacement.**

The errors they will get with the test are:

Looping on “**Status of basic setting:**”

Or if they do get an error

“**The value Requested Action for Routine for the request parameter Record Data Identifier could not be entered.**” Then it loops back again to the same error.

This is for the: **BW-Tiguan & CA/CM-Atlas only with the 2.0L Engine.**

!! The Hotfix must be removed after performing the diagnostic procedure. !!

2.0 – Prerequisite

ODIS Service **latest Diagnostic Content version** must be installed.


To confirm the installed diagnostic content version in ODIS Service, go to:

Info >  **Versions>Diagnostic data; didb_GFS-v.en_US: xxxxxxxx X.XX.XX**



Service Information

3.0 – Download Hotfix

1. Open a **Web Browser** on the diagnostic device and logon to **vwhub.com**
2. Navigate to **Elsa2Go>Service References>Software/Hardware Updates**
3. Search for **ECM Component Adaptation Hotfix Zip File**
4. Click the **ECM Component Adaptation Hotfix Zip File**  and **save** it to your Windows desktop.
5. Close your browser.


(continued)




Service Information

6. Browse to the desktop and double-click the **ECM Component Adaptation Hotfix Zip File** to open it.

7. Right click the file (example only) name and select **Copy**:

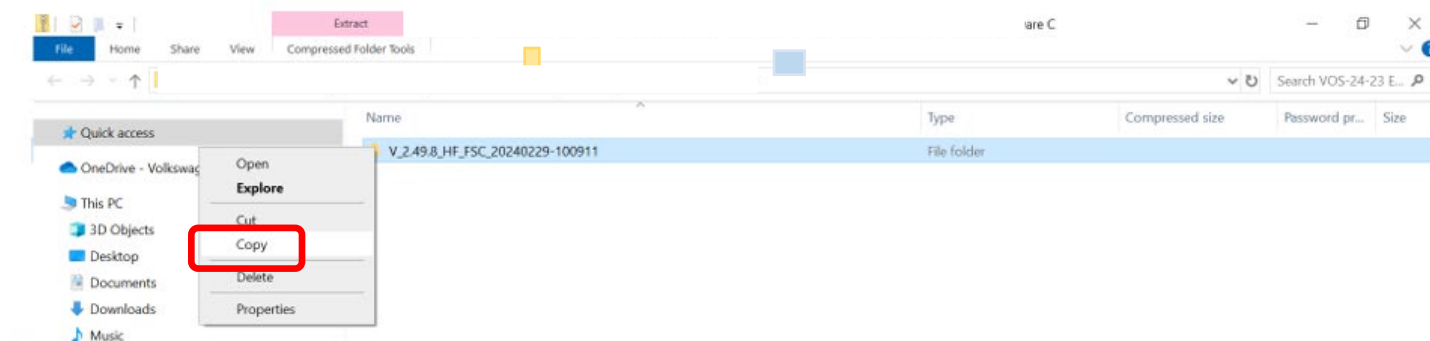

8. Right click anywhere on the Windows desktop and select **Paste**. This file icon (example) must appear on the desktop:

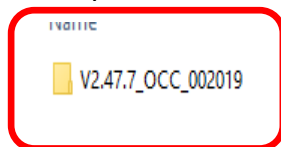

(continued)




Service Information

4.0 – Install Hotfix into ODIS Service

1. Open ODIS Service (“Run as Administrator”)
2. Expand the **Data** submenu and click **Download** (under **Hotfix**):



3. Click **Continue**:

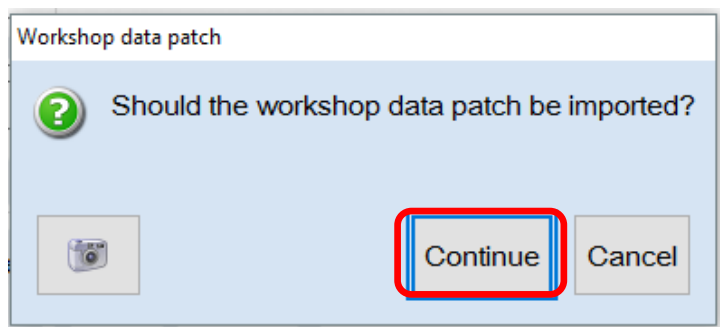


(continued)




Service Information

- The Directory selection window will appear. Browse to and **highlight the Hotfix file** (*example only*), then click **Select Folder**:

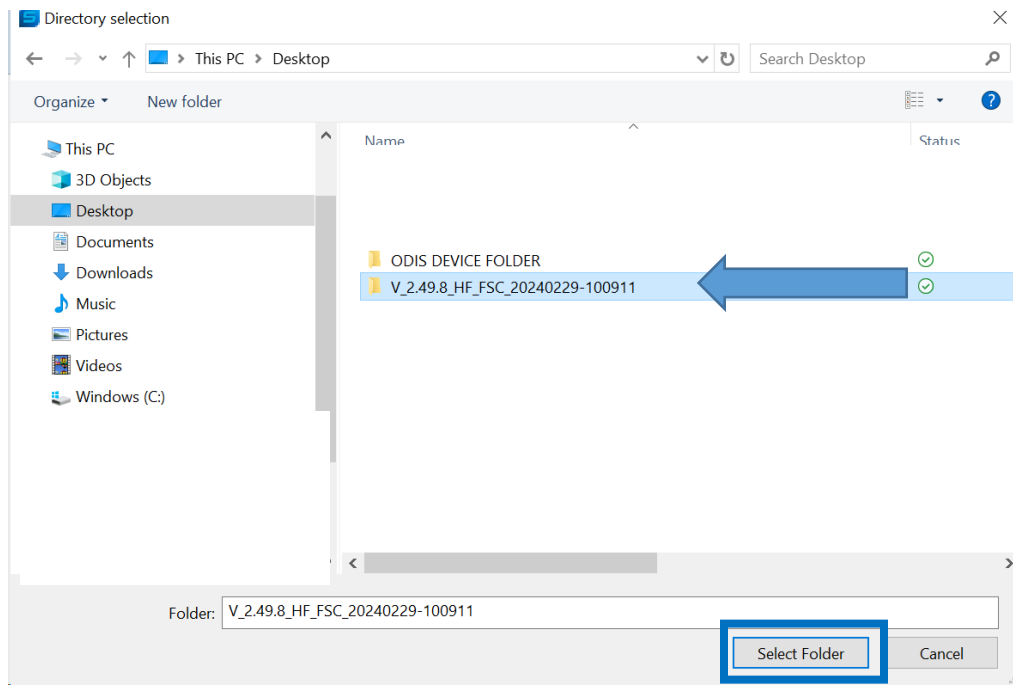

- Click **OK**:

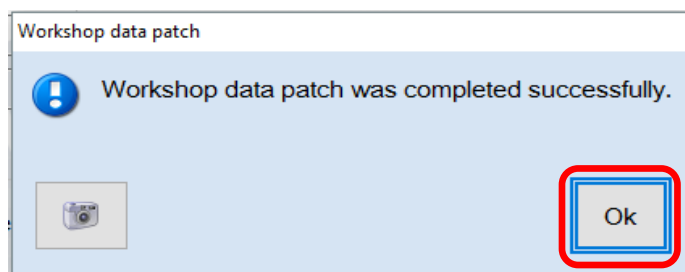

- Perform the diagnostic procedure.

Important:

The Hotfix must be removed after performing the procedure. Failure to do so will cause other vehicle diagnostics sessions to malfunction.


(continued)




Service Information

5.0 – Uninstall the Hotfix from ODIS Service

1. Select **Erase** (under Hotfix), then **Continue**:

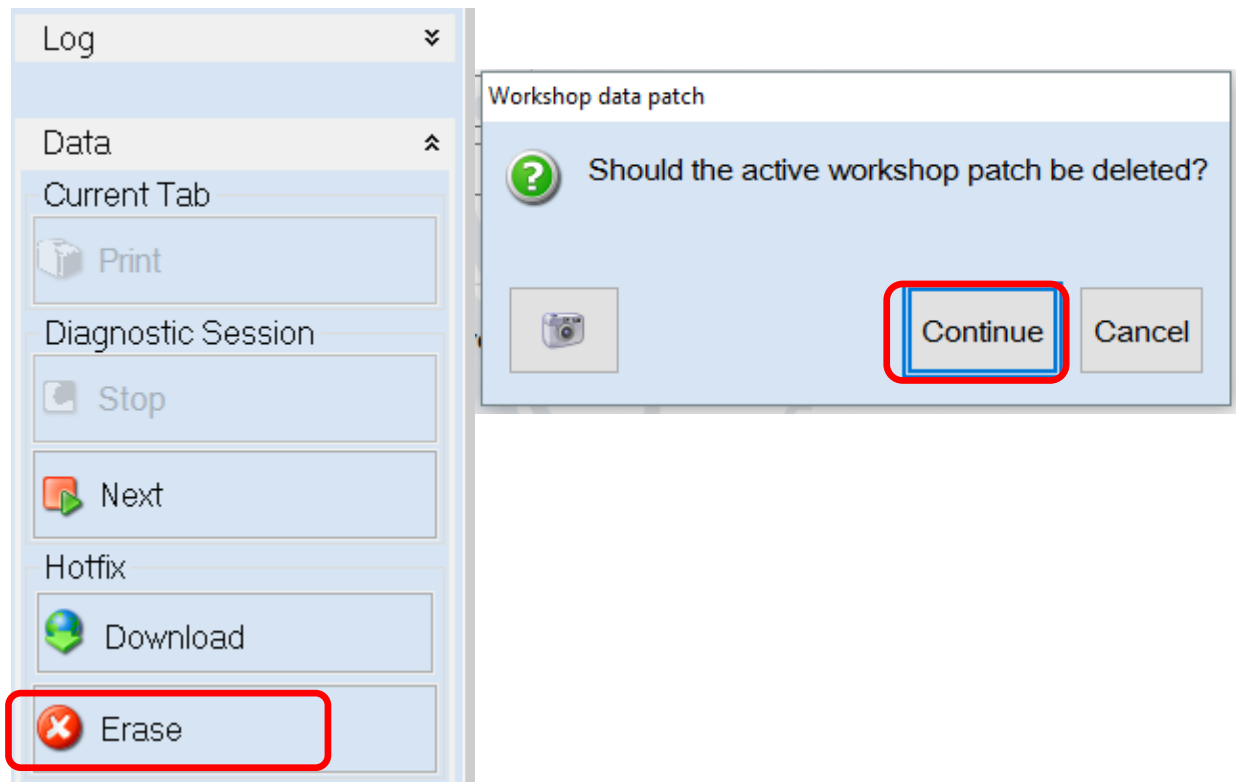

2. Click **OK** and close ODIS Service:

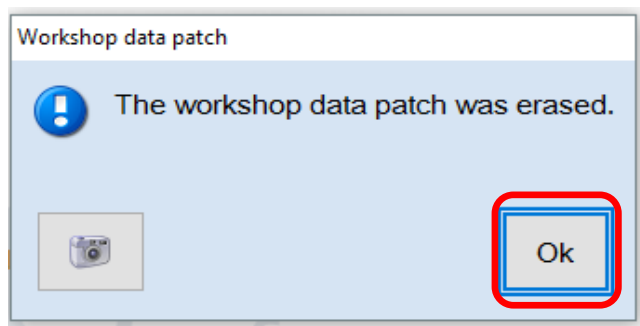

Please contact Diagnostic Tester Software Support by phone at 888-896-1298 or email softwaresupport@vw.com with any questions or concerns.