

MALFUNCTION INDICATOR LAMP(MIL) ON WITH DIAGNOSTIC TROUBLE CODE P0AA6-1A

Customer Voice:

- The instrument panel may display an amber High Voltage (HV) system warning message & a Malfunction Indication Lamp (MIL) at the end of a charging cycle before the charging cable is removed.

Technical Description:

- A compatibility concern between certain makes and models of Mode 4 chargers and the Battery Charge Control Module (BCCM) functionality.
- The MIL will remain illuminated for 3 drive cycles and then, if no other issue is present, extinguish, unless the same charge sequence and equipment are used.

Status:

- Follow TOPIx DTC help text and workshop manual repair guidance for P0AA6-1A HVIL Isolation fault if stored in the Battery Energy Control Module (BECM).
- If the amber warning message continues to be illuminated following charge cable removal or the warning is red, raise a Technical Assist (TA) for the attention of the PTS_120 Engineering team.

Jaguar

- 19-24MY I-PACE

Range Rover

- 18- 24MY Range Rover- PHEV ONLY
- 18 - 24MY RR Sport – PHEV ONLY



Refer to SSM 76171 / SSM 76175