

5. Reflash Speedometer.
 - a. **Click on:** Reflash tab > Speedometer > Check mark
 - b. Click on the speedometer calibration that appears.
 - c. Answer questions and follow directions as they appear on-screen.
 - d. When reflash is completed, click check mark.
6. To verify reflash, go to:
 - a. Toolbox > System Information > Click on SPD tab (if necessary) > SPD/Software Level
 - b. Software Level should read 39 for a completed reflash.
7. Disconnect DT II from vehicle.
8. Turn IGN OFF.

Credit Procedure

NOTE

Enter bulletin number into comment section of claim.

Submit a warranty claim per Table 4.

Table 4. Instrument Reflash

ITEM	DATA
Claim Type	PRD/MC/DEM-PDI/Standard Claim
Problem Part Number	Refer to Table 3.
Quantity	Leave Blank
Primary Labor Code ⁽¹⁾	2721
Labor Time	0.2 hours
Customer Concern Code	9203
Condition Code	2721
(1) Download may be required	

NOTE

Enter M1661 in Event Comments.