



SSM 53108 2024 Mustang - IPC Self-Test Failures - Built On And Before 09-May-2024

Some 2024 Mustang vehicles built on and before 09-May-2024 may exhibit an instrument panel cluster (IPC) concern where an IPC self-test may be required. When performing the IPC self-test, a "Test could not be started. Module programming may have failed" message may show and the IPC will be color-coded as purple in the Ford Diagnosis and Repair System (FDRS) scan tool. To aid in diagnosing customer concerns, diagnostic trouble codes (DTCs) can be retrieved via the All-Continuous Memory DTC (ALL-CMDTC) self-test and normal Workshop Manual (WSM) diagnostics should be performed to address any DTCs present. The self-test communication error will not set any DTCs or affect vehicle operation and if this message is received, IPC replacement or reprogramming will not correct the self-test communication error.