



## **SSM 53151 2025 Explorer - Inoperative Steering Wheel Switches On Both Sides Of Steering Wheel - Built On 16-May-2024 And Through 25-Jun-2024**

Some 2025 Explorer vehicles built on 16-May-2024 and through 25-Jun-2024 may exhibit inoperative steering wheel switches located on both sides of the steering wheel. This may be due to a software concern within the steering column control module (SCCM). To correct this condition, reprogram the SCCM to the latest software level using the Ford Diagnosis and Repair System (FDRS). If the concern is still present, refer to Workshop Manual (WSM) diagnostics in Section 211-05. For claiming, use causal part 3F791 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.