

 Preview Solution CBR-2423-2

Volvo Chassis - Diagnostic Trouble Code (DTC) C103F7A - Air Pressure System Fault After VECU Software Update

Published 15 November 2024

Valid For

Volvo Chassis - VNRe

Model Year - 2022 to current

Following a VECU software update, fault code **C103F7A** may become active. This code indicates a potential air leak or seal failure within the air pressure system, particularly in the electrically controlled air dryer or air processing unit.

Recommended Action

1. Replace the Air Dryer Cartridge:

- Replace the cartridge in the air dryer to address possible fluid leaks or seal issues.

2. Perform Air Dryer Reset:

- After replacing the cartridge, perform a reset of the air dryer system.

3. Clear the Fault Code:

- Attempt to clear fault code C103F7A from the system.

4. If Fault Persists:

- If the fault code remains active after clearing, contact **E-service** for further assistance.

Related links and attachments

No links or attachments available



Share

to others that might find it helpful



Feedback

[Give feedback](#)

to help improve the content of this article