



SSM 53176 2013-2016 Escape - Anti-Lock Brake System (ABS) Warning Indicator With DTC U2300 After The ABS Module Is Replaced

Some 2013-2016 Escape vehicles may exhibit an ABS warning indicator with diagnostic trouble code (DTC) U2300 after the ABS module is replaced. This DTC is set when the module has not learned certain parameters over the controller area network (CAN) from the body control module (BCM). To correct this condition, using the Integrated Diagnostic System (IDS) scan tool, run the programmable module installation (PMI) routine and follow the on-screen instructions. The final prompt in the IDS procedure is a key off prompt. Make sure that the ignition is shut off for at least 30 seconds. Once the PMI is complete, turn the ignition from off to key on engine running (KOER) for at least one minute prior to clearing and checking for DTCs.