

Reference	SSM76215
Models	New Range Rover Sport / L461
Title	Roof Blind Not Operating as Expected
Category	Body
Last modified	13-Nov-2024 00:00:00
Symptom	105000 Roof Options
Attachments	Attachment 14.JPG (Attachment 14.JPG)

Content

Model / Model Year / Derivative:

Range Rover Sport / 23MY onwards / Vehicles with ClearSight Rear-View Mirror

Situation:

JLR Engineering investigations have identified that the Roof Blind may not fully open or could become stuck during operation.

Cause:

Improperly routed and / or improperly secured ClearSight Rear-View Mirror camera wiring harness.

Action:

Refer to the service information below.

Service Information:

1. Obtain an edge clip cable tie (part number LR146981).
2. Secure the edge clip cable tie to the wiring harness breakout for the ClearSight Rear-View Mirror camera as shown in 'Attachment 1'.

NOTE: The wiring harness **MUST** be routed as shown in 'Attachment 1'.

3. Install the edge clip cable tie to the roller blind casing to keep the wiring harness away from the roller blind as shown in 'Attachment 1'.
4. Use the Jaguar Land Rover (JLR) approved diagnostic equipment to clear the Diagnostic Trouble Codes (DTC).
5. Initialize the roof opening panel, (Refer to: Roof Opening Panel Initialization (501-17 Roof Opening Panel, General Procedures).

(Ref 000365782/000374882)