



**Bulletin No.:** PIT6282  
**Published date:** N/A

## Preliminary Information

**PIT6282 Possible Stall Or No-Start . Starter Clicks. DTCs U0140 U0401 U0402 U1611 U1627 U1643 U1818 U1962 U197A U3003 B1A7A Possible**

### Models

**Brand: Model: Model Years: VIN: Engine: Transmissions:**  
**from to**  
 Chevrolet Equinox 2025 All All All All

<b>Involved Region or Country:</b>	North America
<b>Condition:</b>	Customer may experience a stall or no-start with a clicking starter when the Start button is pressed. Any of the following DTCs may be present. U0140 U0401 U0402 U1611 U1627 U1643 U1818 U1962 U197A U3003 B1A7A
<b>Cause:</b>	G111 and/or G112 may not be properly torqued.

### **Correction:**

Inspect G111 and G112 to confirm they are torqued to specifications. Refer to eSI for specifications. If clean and tight, continue with diagnosis.

### Version History

<b>Version</b>	1
<b>Modified</b>	11/12/2024 - Created on.