



Bulletin No.: PIT6279

Published date: N/A

Preliminary Information

PIT6279 Odometer Mileage Incorrect After Performing A Setup Procedure For Any Of The Following Modules ECM / IPC / BCM / Lighting Control Module

Models

Brand:	Model:	Model Years:	VIN: from to	Engine:	Transmissions:
Buick	Envision	2021 - 2023	All All	All	All
Cadillac	Escalade Models	2021 - 2023	All All	All	All
Cadillac	CT4	2021 - 2024	All All	All	All
Cadillac	CT5	2021 - 2024	All All	All	All
Chevrolet	Corvette	2021 - 2024	All All	All	All
Chevrolet	Silverado 2500/3500 HD	2024 - 2025	All All	All	All
Chevrolet	Silverado 1500	2022 - 2025	All All	All	All
Chevrolet	Suburban	2021 - 2023	All All	All	All
Chevrolet	Tahoe	2021 - 2023	All All	All	All
GMC	Sierra 1500	2022 - 2025	All All	All	All
GMC	Sierra 2500/3500HD	2024 - 2025	All All	All	All
GMC	Yukon Models	2021 - 2023	All All	All	All

Involved Region or Country	North America
Condition	A technician may notice an incorrect odometer reading after replacing or performing a SPS setup procedure for any of the following modules: ECM, BCM, Lighting Control Module, or IPC. The mileage will show 999,998 or something near 0.
Cause	Incorrect programming files were deployed into TLC/SPS between October 23rd and 31st. If any of the above modules had the TLC/SPS setup procedure performed during this range, then they MAY have this condition.

Correction:


- 1. Hold the vehicle and do not release the vehicle until the odometer issue is corrected.**
- 2. It is imperative that if a module(s) was replaced then the original module(s) removed from the vehicle needs to be kept.**
- 3. Please setup a TAC case for additional direction and to have an Field Engineer dispatched to help with repairs.**

Warranty Information

Labor Operation	Description	Labor Time
2888058*	TLC/SPS Setup Procedure Error Retrieval	ST
*This is a unique Labor Operation for Bulletin use only.		

Version History

Version	1
Modified	11/08/2024 - Created on.

 GM Global Brands

© 2024 General Motors. All Rights Reserved.