



Technical Service Bulletin

01 Engine: audible whistling or hissing from engine compartment - 2.0 ltr inline 4-cyl. TFSI

01 24 45 2075194/1 November 27, 2024.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q5, and Q5 Sportback	2022 – 2025	All	Not Applicable

Condition

Customer states:

- Whistling or hissing noises from the engine compartment can be heard in the interior when accelerating or suddenly releasing the accelerator.

Workshop findings:

- The customer statement can be reproduced.

Technical Background 1

In some operating situations, the sound of the turbocharger may be transferred into the interior.

Production Solution

Not applicable.

Service

Please see attached instructions.

Proceed as follows:

- Please install the noise insulation for the hood according to the workshop manual.
- Go back and reassess the noise complaint.
- If the noise is still present and the reason for the complaint, use the other measures described in the attached document (butyl cord).



The noise described is normal turbocharger operating noise. In rare cases, this noise may be heard in the vehicle interior. The above measure can be used to reduce the vehicle interior noise.

This is only a comfort complaint. Please explain to the customer that no negative effects on wear or vehicle condition are to be expected.



Technical Service Bulletin

Warranty

Claim Type:	<ul style="list-style-type: none">If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.		
Service Number:	7017		
Damage Code:	0020		
Labor Operations:	Remove and install engine compartment noise insulation	7017 1900	See SRT with associated operations
	(If Necessary) Remove and install cowl panel trim	6644 1950	See SRT with associated operations
	(If Necessary) Seal plenum chamber and perform visual inspection of cap seal	5034 5299	20 TU
Claim Comment:	As per TSB 2075194/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2075194**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.