



**Bulletin No.:** PIP6025


**Published date:** 11/21/2024

## Preliminary Information

### PIP6025 8T65/45 Or 9T45/50/60/65 Transmission Leak Torque Converter Housing Area From Loose Pump Bolts

#### Models

<b>Brand:</b>	<b>Model:</b>	<b>Model Years:</b>	<b>VIN: from to</b>	<b>Engine:</b>	<b>Transmissions:</b>
Buick	Encore GX	2024 - 2025	All All	All All	M3F
Buick	Enclave	2024 - 2025	All All	All All	M3W, MF8
Cadillac	XT4	2024 - 2025	All All	All All	M3H
Cadillac	XT5	2024 - 2025	All All	All All	M3G M3W
Cadillac	XT6	2024 - 2025	All All	All All	M3G M3W
Chevrolet	Blazer	2024 - 2025	All All	All All	M3T M3V
Chevrolet	Equinox	2025	All All	All All	MGH
Chevrolet	Trailblazer	2024 - 2025	All All	All All	M3F
Chevrolet	Traverse	2024 - 2025	All All	All All	MF8
GMC	Acadia	2024 - 2025	All All	All All	MF8
GMC	Terrain	2024 - 2025	All All	All All	M3U, MGH

<b>Involved Region or Country</b>	<b>North America, Japan, South Korea, Europe, Palestine, Middle East</b>
<b>Condition</b>	<p><b>Some Buick, Cadillac, Chevrolet and GMC vehicles equipped with the GF8 8T45/65 or GF9 9T45/50/60/65 automatic transmission may experience: a transmission leak in the torque converter housing area.</b></p> <p><b>The source of the leak could be the 19 pump bolts could be loose.</b></p>
<b>Cause</b>	<p><b>The 19 transmission pump bolts were not fully torqued.</b></p> 

**Correction:**

Check transmission Julian build date.

Julian date between 24 171 and 24 292

Example TUN where Julian date is found: 13241794TKBP0151 (Date Reads 13[24179]4TKBP0151)

The transmission tag is located on the top of the transmission by the control valve body cover.

The Transmission Identification Information Document id # is 4452513 if needed

If the transmission Julian date is between 24 171 and 24 292 and the vehicle comes in with a transmission leak in the torque converter housing area, order the 19 bolts, once bolts and needed parts have arrived remove the transmission and check if the bolts are loose and if loose then replace all 19 bolts, then reinstall the transmission.

The following parts will need to be replaced:

24044946 (comes with 19 bolts)

Please follow SI procedures for repairs and all other recommendations for 1 time use components (gaskets, seals or bolts).

**Parts Information**

Description	Part Number	Quantity
Automatic Transmission Fluid Pump Cover Bolt [19x]	24044946	1

**Version History**

Version	1
Modified	11/21/2024 - Created.