



**Bulletin No.:** PIT6254

**Published date:** 10/7/2024

## Preliminary Information

### PIT6254 Diagnostic Tip: Rear Windows Operate on the Opposite Side and Direction of Command When Using Driver Front Window Switch

#### Models

<b>Brand:</b>	<b>Model:</b>	<b>Model Years:</b>	<b>VIN:</b>	<b>Engine:</b>	<b>Transmissions:</b>
Chevrolet Tahoe		2021 - 2025	from to All All All	All	All

<b>Involved Region or Country</b>	North America
<b>Condition</b>	A customer may comment that when the driver front window switch is used to operate a rear window the opposite side window and direction operates. Example: left rear window is commanded up, the right rear window will move down.
<b>Cause</b>	This may be caused by an upfitter, body shop, or previous repair swapping the left and right rear door harnesses side to side.

#### Correction:

Verify correct left and right rear door harness part numbers are installed on the correct side of the vehicle.

#### Additional SI Keywords

5W4, 9C1, backwards, police

#### Version History

<b>Version</b>	1
<b>Modified</b>	10/07/2024 - Created on.

GM Global Brands

© 2024 General Motors. All Rights Reserved.