



Bulletin No.: PIC6578

Published date: 10/14/2024

Preliminary Information

PIC6578 Diagnostic Tip: Door Windows Will Not Roll All the Way Up and/or Moves Back Down

Models

Brand: Cadillac Lyriq **Model:** Lyriq **Model Years:** 2023 - 2025 **VIN:** All **Engine:** All **Transmissions:** All

Involved Region or Country	North America
Condition	A Customer may comment that a window will reverse when attempting to manually open or while using express up.
Cause	Software home position not aligned with actual window position.

Correction:

With Ignition on, unplug the affected window motor fuse for 1 minute, reinstall the fuse and relearn the window(s).

Left front and rear windows - F50UA.

Right front and rear windows - F52UA.

Version History

Version	1
Modified	10/14/2024 - Created on.

 GM Global Brands

© 2024 General Motors. All Rights Reserved.