



Bulletin No.: PIC6580

Published date: 10/17/2024

Preliminary Information

PIC6580 Diagnostic Tip - Service Theft Alarm Message.

Models

Brand: Model: Model Years: VIN: Engine: Transmissions:
from to
 Cadillac LYRIQ 2023 - 2025 All All All All

Involved Region or Country	North America
Condition	A Customer may comment of a Service Theft Alarm message displaying on the DIC.
Cause	Possible circuit or terminal concern with circuit 728 or 1550 to the P18 Door Lock Status Indicator.

Correction:

Check for the P18 Door Lock Status Indicator located In the driver door panel, at top rear of door panel to be illuminated when the doors are locked.

If the indicator is inoperative, check circuits 728 and 1550 to the P18 Door Lock Status Indicator for a open circuit or terminal issues.

Version History

Version	1
Modified	10/17/2024 - Created on.

 GM Global Brands

© 2024 General Motors. All Rights Reserved.