



Bulletin No.: PIT6269

Published date: 10/29/2024

Preliminary Information

PIT6269 Power Swing Gate Rear Access Button Get Stuck In Rear Left Rear Fascia

Models

Brand: GMC **Model:** HUMMER EV SUV **Model Years:** 2024 - 2025 **VIN:** All **Engine:** All All **Transmissions:** All

Involved Region or Country	North America
Condition	Some customers may state that the rear exterior access button to open the power swing gate is stuck inwards
Cause	This may be caused by the rear gate button in the rear fascia getting stuck by pushing the button sideways or side loading the button

Correction:

Do not replace parts or reprogram the PTM for a sticking button issue. To resolve the concern, just loosen the switch from the backside, recenter the button in the opening, and retorque the button. Push the button to verify it's no longer sticking, then reinstall the fascia.


Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
1486088	Rear Door Access Control Pushbutton Adjustment	1.5 Hr.

Version History

Version	1
Modified	10/29/2024 - Created on.

 GM Global Brands

© 2024 General Motors. All Rights Reserved.