



Bulletin No.: PIT6235A

Published date: 12/3/2024

Preliminary Information

PIT6235A MIL Illuminated-Various Warning Messages

Models

Brand: Model: Model Years: VIN: Engine: Transmissions:
from to
 Chevrolet Blazer EV 2024 - 2025 All All All All

Involved Region or Country	North America
Condition	<p>Service high voltage message, shift to park message or others. May not shift out of park.</p> <p>Codes B2BBC B2BBD P0607 P0CC8 P1916 P1939 U11FD U053B U0073 U0131 U0140 U0151 U164E U0411 U0412 U0418 U1610 U1659 U1961 may be set or other codes may be set.</p> <p>Any of these symptoms or codes or others may be displayed depending on which circuits are affected.</p>
Cause	Harness chafed at edge of cowl causing damage to circuits.

Correction:

Inspect the harness in the area shown below for damage.

If damage is found, repair the circuits per SI.

Wrap the harness in tape or conduit and route it away from the cowl.







Additional SI Keywords

24, 2024, B2BBC, B2BBD, Blazer EV, chafe, circuit, cowl, firewall, high, harness, P0607, P0CC8, P1916, P1939, rub, short, U11FD, U164E, U1961, voltage, warning, wear, worn

Version History

Version	2
Modified	09/10/2024 - Created on. 12/03/2024 - Updated Correction.

 GM Global Brands

© 2024 General Motors. All Rights Reserved.