



Bulletin No.: PIT6202C
Published date: 12/5/2024

Preliminary Information

PIT6202C Hood Ajar Message Illuminated On The IPC With DTC B1C8D, B1C8C, B1C80, B1C81, P257F

Models

Brand:	Model:	Model Years:	VIN: from to	Engine:	Transmissions:
Chevrolet	Silverado EV RST	2024 - 2025	All All	All	All
GMC	Hummer EV	2022 - 2025	All All	All	All
GMC	Hummer EV SUV	2024 - 2025	All All	All	All
GMC	Sierra Denali EV	2024 - 2025	All All	All	All

Involved Region or Country	North America
Additional Options (RPO)	AHV Power Hood Control
Condition	A customer/driver could see a " Hood Ajar " message that displays on the IPC along with one or more of the following DTC's: B1C8D, B1C8C, B1C80, B1C81, P257F.
Cause	The eTrunk has lost its learned position.

Correction:

Technicians are instructed to remove and reinstall the K241 Powertrain Compartment Cover Module (F54UA) fuse and then perform a relearn of the Power Front Compartment Module by following Document ID: 6616845 in Service Information.

The eTrunk is designed to be opened and closed using either of the three methods:


- Key Fob
- Switch on the instrument panel to the left of the steering wheel
- The touchpad right of center of the front fascia (shown below for different models)

NOTE: When using the Key fob or the switch in the Instrument panel to close the hood, press and hold the hood open button until the hood closes. Releasing the button will stop the hood motion.

2024 Silverado RST



2024 Sierra Denali EV

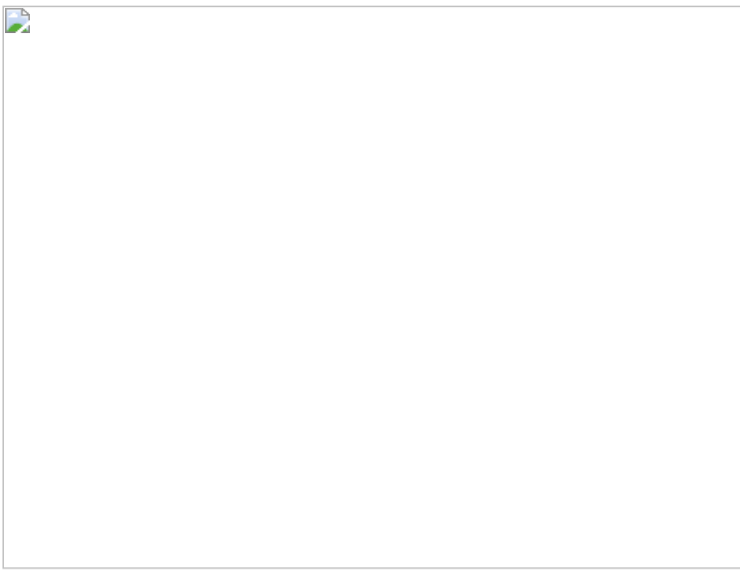

2022-2025 Hummer EV Models



NOTE: Manually forcing the hood to open or close can damage the vehicle. Always allow the automatic operation to complete before using the hood again.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation.

Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
2086738	Power Front Compartment Module Reset and Relearn	0.3 Hr.
*This is a unique Labor Operation for Bulletin use only		

Version History

Version	4
Modified	07/23/2024 - Created on. 08/20/2024- Update name of module to match service terms. 09/13/2024- Updated Models. 12/05/2024- Update model year and add labor operation.