



Service Bulletin

Bulletin No.: 24-NA-255

Date: November, 2024

TECHNICAL

Subject: Air Bag Warning MIL with DTC B14DC

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade Escalade ESV	2023	2025				
Chevrolet	Suburban	2023	2025				
	Tahoe						
GMC	Yukon Yukon XL	2023	2025				

Involved Region or Country	North America
Condition	Some customers may comment on a Service Restraint System Message and/or SIR Warning MIL intermittently illuminated. When checking for DTC's, a B14DC will be found.
Cause	The cause of the condition may be due to a temporary loss of contact with the airbag connector terminals at the F106DA Front Seat Inboard Seat Back Airbag.
Correction	<p>Access the airbag connector:</p> <ol style="list-style-type: none"> 1. Disable the airbag, refer to <i>SIR Disabling and Enabling</i>. 2. Gain access to the Front Seat Inboard Airbag Connector, refer to <i>Front Seat Back Cover and Pad Replacement</i> and <i>Front Seat Inboard Seat Back Airbag Replacement</i>. 3. Locate the connector and perform a connector disconnect and reconnect of the F106DA Front Seat Inboard Seat Back Airbag connector, ensuring the connector is properly installed and seated. Clear DTCs. <ul style="list-style-type: none"> • If DTC B14DC returns, then replace the connector. Refer to the Service Procedure below. • If DTCs clear, then reseal the seat and return to the customer.

Service Procedure

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

1. Locate the airbag connector and disconnect it.



6763702

2. Unseal and loosen the connector, then cut the wires closer to the wire harness.





6763709

3. Open the new connector and measure out the length of the wire required.
4. Then splice in the new connector wires. Refer to *Wire to Wire Repair*.



6763715

5. Reseal the connector wires and re-secure the connector with zipties. Then, reconnect the airbag connector.
6. Verify DTCs have cleared then reassemble the front seat rear compartment.

Parts Information

Causal Part	Description	Part Number	Qty
X	Airbag Inflator Connector	13530533	1

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
*6486258	Disconnect and Reconnect Front Seat Airbag Connector	.8 hr
*6486268	Replace Front Seat Airbag Connector	1.0 hr
Add	Verify DTCs Cleared	.1 hr

*This is a unique Labor Operation for Bulletin use only.

Version	1
Modified	Released November 12, 2024

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, **DO NOT** assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



**WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION**