



SSM 53215 2024 Mustang - Dark Horse™ - Manual Transmission - Illuminated MIL With DTCs P0300, P0302 And P0308 Stored In The PCM

Some 2024 Mustang Dark Horse™ vehicles equipped with a manual transmission may exhibit an illuminated malfunction indicator lamp (MIL) with diagnostic trouble codes (DTCs) P0300, P0302 and P0308 stored in the powertrain control module (PCM) from extended high speed or racetrack operation (driving the vehicle and allowing the engine to hit maximum engine speed, several times and in a short period). Normal driving conditions will not induce this condition. To correct the condition, download and run the "PCM - Powertrain Control Module (PCM) Misfire Monitor Profile Correction Learn" app in the Ford Diagnosis and Repair System (FDRS) scan tool. Use the "Submit Global Concern Report (GCR)" link at the upper right of the OASIS report to submit if a vehicle comes in for this condition. For claiming, use causal part 12A650 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.