



SSM 53226 2020-2021 F-Super Duty - Diagnostic Trouble Codes (DTCs) U024B And/Or U024C Stored In APIM After SCMG And/Or SCMH Software Update

Some 2020-2021 F-Super Duty vehicles which have received a seat control module-G (SCMG) and/or seat control module-H (SCMH) software update using the Ford Diagnosis and Repair System (FDRS) scan tool may set DTCs U024B and/or U024C in the auxiliary protocol interface module (APIM). This is the result of a misconfiguration of the SCMG and/or SCMH during the software update. To correct the condition, download and run the SCMG-configuration app, followed by the SCMH-configuration app. Once the configuration app completes, run all continuous memory DTCs self-test to verify that the APIM DTCs U024B and/or U024C clear. If the DTCs remain, refer to the appropriate Workshop Manual (WSM) section for further diagnostics.