

SSM 53230 2021-2023 F-150 - DTC U023A:08 After SCCM Reprogramming

Some 2021-2023 F-150 vehicles may exhibit diagnostic trouble code (DTC) U023A:08 with the automatic high beam feature operating correctly after reprogramming the steering column control module (SCCM). To confirm the automatic high beam feature is working when this DTC is present, cover the light sensor in the middle of the dashboard. If the auto high beam indicator is illuminated in the instrument panel cluster (IPC), this DTC does not affect vehicle durability and no additional diagnosis or service is required for this condition and replacement or reprogramming of the SCCM or image processing module A (IPMA) will not resolve this condition. If the auto high beam indicator does not illuminate when the light sensor is covered, refer to the Workshop Manual (WSM) for diagnostics.