



Service Bulletin

Bulletin No.: 24-NA-181
Date: November, 2024

TECHNICAL

Subject: No Reverse, Will Not Shift Past 3rd Gear, Malfunction Indicator Lamp (MIL) Illuminated - DTC P2732 Set

Brand:	Model:	Model Year:		Build Date:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Silverado 1500	2024	2024			L84	MHT
GMC	Sierra 1500						

Involved Region or Country	North America
Condition	Some customers may comment on one or more of the following conditions: - No reverse - Transmission will not shift past 3rd gear - MIL illuminated Note: Having no reverse, will not set DTC P2732. Some technicians may comment find DTC P2732 (Transmission Control Solenoid Valve 6 Stuck Off) set in the Transmission Control Module (TCM).
Cause	This condition may be caused by Internal Valve Body Concern.
Correction	Replace the Control Valve Body.

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Service Procedure

Refer to *Control Valve Body Replacement*.

Parts Information

Note: Only select the parts that coincide with the repair performed. Replace the part with the P/N outlined in the Electronic Parts Catalog (EPC) in accordance with the vehicle VIN.

Causal Part	Description	Part Number	Qty
X	VALVE ASM-CONT (W/ BODY & VLV)	24065351	1
N/A	SEAL-A/TRNS AUX FLUID PUMP	24047734	1
N/A	SEAL-EXH MANIF PIPE (Left)	15035747	1
N/A	SEAL-EXH MANIF PIPE (Right)	15077362	1
N/A	Fluid A/Trans (ULV) US	19352619	As Required
N/A	Fluid A/Trans (ULV) Canada	19352620	As Required

Warranty Information

For vehicles repaired under the Emission coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
8486418*	Control Valve Body Replacement for No Reverse and/or Will Not Shift Past 3rd Gear	3.0 hr
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	Released November 13, 2024

