

MAS004483 RU 24-45

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



Maserati

PERSONAL SERVICE LAB

MASTERS OF CARE

TECHNICAL SERVICE OPERATIONS

Rapid Update 775 Maserati Levante and Ghibli – DMTL pipe connection check



DATE: December 11, 2024

Certain Maserati Ghibli (M157) and Levante (M161) MY24 listed in MODISCS+ are involved in a Rapid Update to verify and possibly restore the correct connection of the pipe that links the canister to the DMTL.

Procedure involve checking the pipe and make sure it is connected and secured correctly

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before ordering parts and/or starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions.

Thank You for your continued support and cooperation.


Maserati North America
Aftersales Dept.

Technical Procedure



All images shown in this bulletin are for illustrative purposes only

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Proceed to remove the right rear wheel and the wheel guard following the instructions in the workshop manual:
 - a. **9.13.005 - REAR RH WHEEL COMPARTMENT FRONT GUARD - Removal/refitting or replacement**
3. Identify the pipe from the fuel vapor filter to the diagnostic pump (DMTL) and check that the Quick Connector is **correctly engaged** on the vapor filter, checking that there are no foreign bodies on the pipe (see for example protective caps).

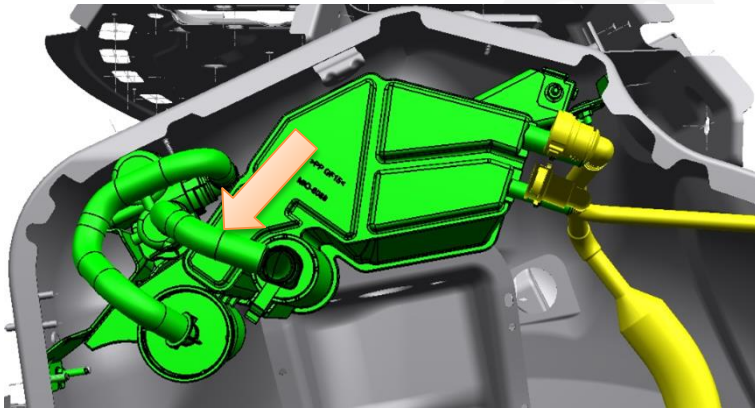

4. Repair any non-conformities and reassemble the dismantled components by proceeding in reverse order to the disassembly procedure.
5. Procedure complete.

Warranty Claim

Please complete the warranty request as follows:

Description	Code
Number of Rapid Updates	775
Warranty code	23
Error code	063
Component Code	1.44.023
Operation Code <ul style="list-style-type: none">▪ Check	1.44.023.A (0.25 h)