



Bulletin No.: PIT6307

Published date: 12/17/2024

Preliminary Information

PIT6307 Diagnostic Aid: unwanted chime while operating at highway speeds

Models

Brand:	Model:	Model Years:	VIN: from to	Engine:	Transmissions:
Chevrolet	Suburban	2023 - 2024	All All	All	All
Chevrolet	Tahoe	2023 - 2024	All All	All	All
GMC	Yukon	2023 - 2024	All All	All	All
GMC	Yukon XL	2023 - 2024	All All	All	All

Involved Region or Country	North America
Additional Options (RPO)	UD5
Condition	Some customers may comment on a unwanted chime while driving at highway speeds. In some cases, it has been noticed that the LED in the Park Assist switch will flash. Dealer may find one or all Front Park assist sensor codes set, DTC B19BB, B19BC, B19BD, B19BE and B1A30.
Cause	The cause of this condition could be the front park assist sensor harness chaffing on inner bumper tie bar, as shown below.



Correction:

Inspect the front park assist sensor harness and repair harness as needed.

Note, The front fascia will need to be removed for inspection.

Warranty Information

For vehicles repaired under warranty, please refer to latest version of bulletin [10-00-89-005](#) for warranty information.

Version History

Version	1
Modified	12/17/2024 - Created on .