



SIB 51 32 24

2024-12-02

## DELIVERY STOP: REAR BUMPER BRACKET

This Service Information Bulletin (Revision 1) replaces SI **B41 08 24** dated **November 2024**.

**What's New:**

- SIB number changed
- Situation updated
- Correction added
- Procedure added
- Parts information added
- Claim information added


☐ THIS REPAIR IS MOBILE FRIENDLY

**MODEL**

E-Series	Model Description	Production Date	Affected Option Code
G07	X7 Sports Activity Vehicle	October 14, 2024	(05AS Active Driving Assistant) and/or (5AU Driving Assistance Pro)

**AFFECTED VEHICLES**

- Vehicles which require this campaign to be completed will show it as “Open” when checked either in AIR, AWP, Campaign Summary, or Warranty Vehicle Inquiry.
- Please make sure you check your dealer inventory as soon as possible. You can see a list of affected vehicles in Inventory Campaign Details (ICD) under ROSS.

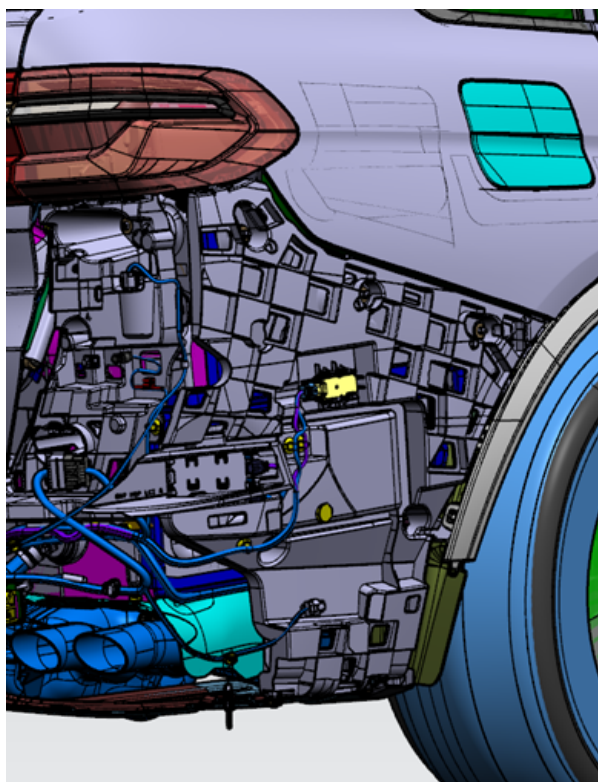**SITUATION**


BMW AG has issued a Delivery Stop (effective November 4, 2024) on a small number of Model Year 2025 BMW vehicles that were produced on October 14, 2024.

Vehicles produced on October 14, 2024, with option code(s) 05AS (Active Driving Assistant) and/or 5AU (Driving Assistance Pro); and have a short-range radar sensor (SRR sensor) clipped into the left and right rear of the vehicle. The short-range radar sensor (SRR sensor) on the right rear of the vehicle may come loose while driving.

A loose short-range sensor (SRR sensor) may cause a fault in the driver assistance system which is displayed to the customer via a check control message (CCM). In individual cases, the performance of this driver assistance function maybe reduced/not functioning if the vehicle is being approached from the right rear.

**Note:** The yellow highlighted component in the photo is the short-range radar sensor (SRR sensor).

**CORRECTION**

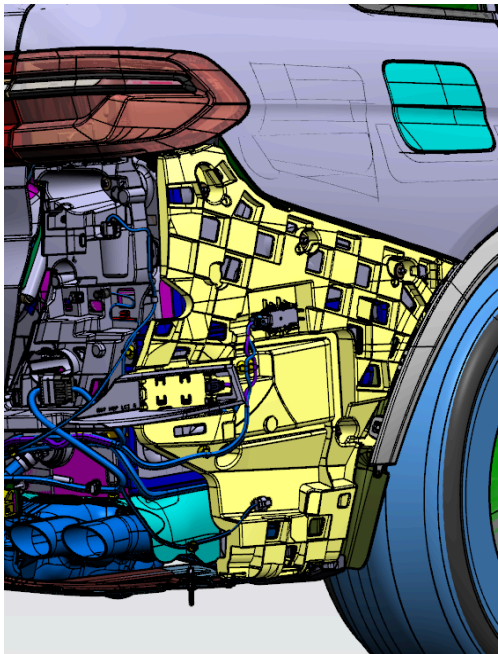

Replace the right rear mounting bracket.

**Note:** The yellow highlighted component in the illustration is the right rear mounting bracket.

**PROCEDURE**

Replace the right rear bumper bracket following the repair instructions listed in ISTA/AIR 51 12 160.

**PARTS INFORMATION**

Use and invoice the part number listed below.

Part Number	Description	Quantity
51 12 8 084 142	Mount, bumper rear right	1

Additionally, other materials and small parts that are not specified above, such as fluids, lubricants, one-time use screws, nuts, and seals, which must be replaced or installed (according to the ISTA repair instructions/ETK/AIR), are to be selected from the Electronic Parts Catalog, and/or other approved BMW Group resources according to the respective vehicle type. Invoiced these items separately under the Repair Code listed in this bulletin.

**CLAIM INFORMATION**

Reimbursement for this Action will be via normal claim entry utilizing the applicable work package information below and the part number listed above.

Repair Code:	0051120600	---
--------------	------------	-----

Below are the special flat rate labor operation code choices for this action.

**Completion before the first vehicle delivery to a customer or the vehicle is already in the workshop.**

Work Pkg	Labor Operation	Description (Plusposition)	Labor Allowance
# 1	00 77 791	Replacing the rear right bumper mounting	12 FRU

Or:

**The vehicle arrives at your center and this Action shows open (No other Main work will be performed or claimed during this workshop visit).**

Work Pkg	Labor Operation	Description (Main work)	Labor Allowance
# 2	00 77 220	Replacing the rear right bumper mounting	14 FRU

Only one of the flat rate labor operation codes listed above can be used for claim submission and reimbursement. Also, only one Main work flat rate labor operation code can be claimed per workshop visit.

Or:

**Completion in conjunction with another repair that required the removal or replacement of the rear bumper panel.**

Work Pkg	Labor Operation	Description (Main work)	Labor Allowance
# 3	No Labor	In conjunction with another repair, rear bumper panel removed (Part only)	N/A

**Claim Repair Comments**

Only reference the SIB number and the work package (Pkg) number performed in the technician’s RO notes and in the claim comments (For example: B51 32 24 WP 1), unless otherwise required by State law.

**Alternative Mobility Solution (AMS) for Vehicle Owners (RO and Claim Comments Required)**

This Action’s repair qualifies for Alternative Mobility Solution (AMS) expense reimbursement, claim this item under the Defect Code noted above as follows:

Sublet Code 2 - Itemize the AMS sublet amount on the repair order and in the claim comment section.

Please refer to [SI B01 29 16](#) for additional information.

**FEEDBACK REGARDING THIS BULLETIN**

Technical Feedback	To submit feedback for the technical topic of this bulletin: Submit your feedback in the rating box at the top of this bulletin
Warranty Feedback	To submit feedback for the CLAIMS section of this bulletin: Submit an IDS ticket to the Warranty Department, or use the chat available in the Warranty Documentation Portal
Parts Feedback	To submit feedback for the PARTS section of this bulletin: Submit an IDS ticket to the Parts Department

