

MAS004331 RU 24-46

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



Maserati

PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 741 GranTurismo GranCabrio BEV – Side Air Vent Replacement

TECHNICAL SERVICE OPERATIONS



DATE: December 17, 2024

Certain Maserati GranTurismo GranCabrio BEV (M189) MY24 listed in MODISCS+ are involved in a Rapid Update to replace the front side vent trims.

Some details were found to be out of tolerance and may have been mounted on the vehicle incorrectly which could cause a gap and consequently cause moisture to infiltrate which can lead to internal LED light side vent light malfunction. The procedure involves a replacement of both the aesthetic trims and the electrical wiring.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before ordering parts and/or starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions.

Thank You for your continued support and cooperation.

Maserati North America
Aftersales Dept.

Technical Procedure

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Safely lift the vehicle and replace the front fender bridles on both the right and left sides of the vehicle. The instructions for the correct procedure are given in the workshop manual.
 - **9.15.268** FRONT FENDER BRIDLE WITH RIGHT SIDE VENTILATION LIGHTS
 - **9.15.269** FRONT FENDER BRIDLE WITH LEFT SIDE VENTILATION LIGHTS
3. Proceed to replace all the plates, three on each side, following the instructions contained in the workshop manual.
 - **9.15.047** FRONT FENDER AIR OUTLET VENT. DX. Removal-Reattachment or Replacement
 - **9.15.048** FRONT FENDER AIR OUTLET VENT. SX. Removal-Reattachment or Replacement
4. Reassembled components by proceeding in the reverse order of the disassembly procedure.
5. Procedure complete.

Spare Parts

Spare parts	Qty	Pn
RIGHT AIR OUTLET PLATE	3	670286748
LEFT AIR OUTLET PLATE	3	670286749
RIGHT FRONT SIDE WIRING	1	670354009
LEFT FRONT SIDE WIRING	1	670354010

Warranty Claim

Complete the warranty request as follows:

Description	Code
Rapid Update number	741
Warranty code	23
Error code	063
Component Code	9.15.047
Operation Code <ul style="list-style-type: none">▪ Replacing bridles + air vents (2 sides)	9.15.047. A (1.05 h)