



Service Bulletin

Bulletin No.: 21-NA-240

Date: December, 2024

INFORMATION

Subject: Information on Oil Leak from Cam Carrier T-joint Area

This Service Bulletin replaces PIP5755. Please discard PIP5755.

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission :
		from	to	from	to		
Cadillac	CT4	2020	2024	—	—	2.0L Turbo (LSY)	—
	CT5						
	CT6						
	XT4	2019	2024				
	XT5						
	XT6						
Chevrolet	Blazer	2020	2024				
GMC	Acadia	2020	2023				

Involved Region or Country	North America, Europe, Russia, Middle East, Israel, Palestine, Chile, Colombia, Ecuador, Peru, Japan, Cadillac Korea (South Korea)
Condition	Some customers may comment on an oil leak from the top of engine area.
Cause	This condition may be caused by improper amount of sealant used to seal the cam carrier gasket.

Information	<div style="text-align: center;"> </div> <p style="text-align: right; margin-top: 20px;">5911107</p> <p>If you encounter a vehicle that is experiencing an engine oil leak from the front of the engine, proceed with the following:</p>
--------------------	--

	<ol style="list-style-type: none"> 1. Remove all residual oil from the front of the engine, add oil dye and allow the engine to run until a leak is observed. 2. Once a leak has been observed, inspect the front of the engine Cam Carrier T joint area for potential source of the oil leak. <p>⇒ If the oil leak has been isolated to the Cam Carrier T joint area, refer to <i>Camshaft Carrier Replacement</i> in SI for resealing the Cam Carrier Assembly.</p> <p>The graphic above shows the Cam Carrier T joint area using a black light to highlight the oil dye.</p>
--	---

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4061050	Camshaft Carrier Replacement	Use the Published Labor Operations Time

Version	2
Modified	Released October 21, 2021 December 05, 2024 - Added 2023-2024 Model Years and Added Warranty Information section.

