



Bulletin No.: PIT6311
Published date: 12/20/2024

Preliminary Information

PIT6311 U0265 Stored No Communication With FVCM After Camera Replacement

Models

Brand:	Model:	Model Years:	VIN: from to	Engine:	Transmissions:
Chevrolet	Colorado	2024	All All	All	All
GMC	Canyon	2024	All All	All	All

Involved Region or Country:	North America
Additional RPOs	UHY - KSG
Condition:	Cannot perform camera learn after replacement for another issue. FVCM will not communicate with GDS but does show present on CAN2 when using the CAN Bus Diagnostic Tool. U0265 stored in multiple modules.
Cause:	Potential issue with the EPC providing multiple part numbers to select from when using the VIN Filter.

If you have this concern after a camera replacement it is possible the incorrect part has been installed. If the part number on your original camera was 85026801 , it should be replaced with part number 85026803. The EPC is being updated and this PI will be removed after the corrections are in place.

Version History

Version	1
Modified	12/20/2024 - Created on.