

# Technical product information

<b>Topic</b>	Rear mood lighting strip replacement guidelines
<b>Market area</b>	Bentley: worldwide (2WBE), China 796 VW Import Comp. Ltd (Vico), Beijing (6796)
<b>Brand</b>	Bentley
<b>Transaction No.</b>	2075533/1
<b>Level</b>	EH
<b>Status</b>	Approval
<b>Release date</b>	

## New customer code

Object of complaint	Complaint type	Position
lighting system, signalling -> interior illumination -> background lighting	functionality -> uneven	
lighting system, signalling -> interior illumination -> background lighting	functionality -> without function / defect	
lighting system, signalling -> interior lighting -> door light strip	component / consumables -> damaged	
lighting system, signalling -> interior lighting -> fluorescent tube	component / consumables -> damaged	
lighting system, signalling -> interior lighting	functionality	

# Vehicle data

## Flying Spur

### Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
ZG2*	2020	E		*	*	*
ZG2*	2021	E		*	*	*
ZG2*	2022	E		*	*	*
ZG2*	2023	E		*	*	*
ZG2*	2024	E		*	*	*

# Documents

Document name
<a href="#">master.xml</a>

-----

## Customer statement / workshop findings

Refer to the Technical background section

## Technical background

In the event the rear mood light (figure 1) is reported to be defective please refer to the instructions within the Measure section of this TPI

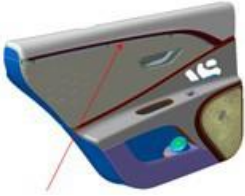


Figure 1

### NOTICE

**IMPORTANT NOTICE: The rear mood lighting LED Module can now be ordered and replaced individually - DO NOT REPLACE THE DOOR TRIM ASSEMBLY**

## Production change

Not Applicable

## Measure

### CAUTION

**Prior to starting the instructions within this TPI, the Retailer must check and confirm the vehicle is in standard factory condition and has not had any non-approved aftermarket modifications conducted**

Should any aftermarket modifications be found, the retailer must make Product Support aware by raising a DISS query to report the details of the modification, you must then await feedback from Product Support before conducting any further work



**In the event that non-approved aftermarket modifications have not been conducted the operative should proceed from Step 1**

- 1) Check the integrity of the applicable rear mood light strip electrical circuit - Refer to Elsa pro wiring diagrams
- 2) Check the rear mood light strip electrical connections are correctly made to the affected mood lighting strips, if not connected correctly - Refit and confirm connection - Retest
- 3) Should the connector or mood light be confirmed as defective - Replace the rear mood lighting LED Module as described within Rep.Gr 96 - Mood lighting strips - To remove and fit

## Warranty accounting instructions

Warranty Type 110 or 910

Damage Service Number 94 04

Damage Code 00 40

### Time to remove and refit the rear door trim

Labour Operation Code 70 73 19 00

Time 20 TU

### Time to replace the rear door mood lighting LED Module

Labour Operation 94 04 19 55

Time 10 U

## Parts information

Mood light LED Module - 3SA 947 355T