

Audi On-car analysis list from December, 04 2024

Please contact Audi Helpline before attempting repair

As of 6/7/2024 worksheets will no longer be used as a standard practice. Worksheets will only be required if listed in the topic details.

	Models	MY	Engine	Trans	Topic	Topic details
	Q5	2023, 2024	DSMA	Any	Mil on - DTC P256300 "turbocharger boost control position sensor circuit range/performance"	Before performing work on the vehicle proceed as follows: 1. Verify DTC P256300 "turbocharger boost control position sensor circuit range/performance." 2. Please take photos of the control rod. 3. Is the screw on the control rod loose. If so, is there any indication why it is loose.
	A8, S8	2022-2025	Any	Any	Creaking noise in front instrument panel area – Front suspension strut tower brace bolts loose	<ul style="list-style-type: none"> • See TSB 2066526. If vehicle presents with the issue described in the TSB: <ul style="list-style-type: none"> Photo / video document the issue specifically which bolts are loose. Photo / video documentation should include imaging at a distance showing location as well as close-up photos showing which bolts are loose. Replace the strut tower brace and all bolts. Either mark each bolt such that their original position can be determined -or- secure the bolts to the brace in their original locations using tape, wire, etc. • TAC case submitted with Worksheet "Creaking noise in front instrument panel area as in TSB 2066526". • Retain all parts for return to WPRC • Provide a short description of the customer's concern and under what conditions the noises are elicited. • Also PID 5069