

**Additional Coolant Pump Fault (POC4700) Causes MIL**

**Vehicles Affected**

Models	Model Year	Model Type	VIN Range	Vehicle-Specific Equipment
Cayenne	2015 - 2017	92A	n/a	PHEV

**Revision History**

Revision	Release Date	Changes
0 (ATI Grp 1 1704)	September 26, 2017	Original document
1 (ATI Grp 1 1801)	February 8, 2018	Update of Service Information
2	March 1, 2023	Update of PartID
3	December 16, 2024	Service Information - Addition of part numbers

**Condition**

The customer observes a Malfunction Indicator Lamp (MIL). (Note: Typically, this MIL is the only symptom of this issue.)

**Technical Background**

The technician confirms the MIL and notes POC4700 is present in the high-voltage battery.

## Advanced Technical Information

### Service Information

New guided fault finding appears in PIWIS tester version 37.000 and higher. Please follow the instructions given in this resource before proceeding with the information in this ATI.

In many cases, technicians noted one or more of the following root causes:

- a) Corrosion on Ground Pin 6B (See figures 1 and 2.)
- b) Corrosion on the connector to the secondary low temperature coolant pump.
- c) A bad ground or otherwise unsound wiring.

The service recommendation is to check the ground, connector, and wiring for corrosion and circuit continuity. Repair the ground, connector, or wiring as needed. Sometimes, the ground bolt is painted and not adequately conductive. In this case, clean the ground bolt and eyelet using a wire brush and sandpaper. If the ground, connector, and wiring are acceptable, replace the electric water pump (958.606.567.00 - auxiliary coolant pump) and the electric water pump relay (958.615.008.01 - coolant pump relay).

Looking into right front wheel well through the headlamp area (Driver side similar)

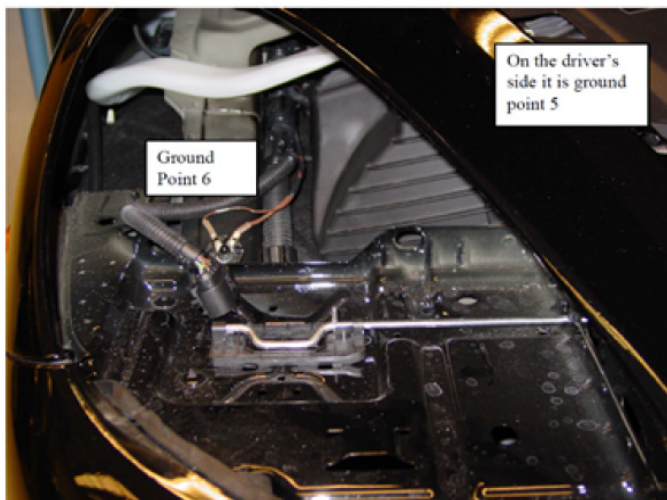


Figure 1 - Ground PIN 6B



Figure 2 – Example of corrosion on ground point

### Warranty

As always, be sure to document the repair completely in PQIS.

For this repair, please code the "cause" as follows:

Cause location: 82720 Circulating pump

Cause symptom: 1611 No function

---

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

---