



Service Bulletin


Bulletin No.: 22-NA-249

Date: December, 2024

TECHNICAL

Subject: Add-on Accessories Intermittently Lose Power

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Tahoe	2021	2023				

Involved Region or Country	North America, Middle East
Additional Options (RPOs)	9C1: SALES PACKAGE-POLICE VEHICLE (PPV) SW4: SALES PACKAGE-SPECIAL SERVICE, MUNICIPAL (SSV)
Condition	Some customers may comment that the add on accessories intermittently lose power.
Cause	 <p style="text-align: right;">6214193</p> <p>This condition may be caused by poor terminal tension at pin 36 at the X51AX connector.</p> <ul style="list-style-type: none"> - Battery power circuit 2742 intermittently opens due to a poor terminal pin grip to the bus bar relay center terminal.
Correction	If the terminal has been found to be loose in the connector, replace the terminal.

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Service Procedure

Refer to *Wire to Wire Repair*.

Parts Information

Causal Part	Description	Part Number	Qty
N/A	WIRE KIT, SPLICE	84764079	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
5430902	Wire-to-Wire Repair	Use the Published Labor Operations Time

Version	2
Modified	Released January 19, 2023 Revised December 19, 2024 - Updated the Electrical Connector in the Cause section.

