



Bulletin No.: PIT6134G
Published date: 01/6/2025

Preliminary Information

PIT6134G Premature Front Brake Pad Wear

Models

Brand:	Model:	Model Years:	VIN: from to	Engine:	Transmissions:
Chevrolet	Silverado 1500	2019 - 2021	All	All	All
Chevrolet	Silverado 1500 LTD (RPO J21, VIN Digit 5 = W or Y)	2022	All	All	All
GMC	Sierra 1500	2019 - 2021	All	All	All
GMC	Sierra 1500 Limited (RPO J21, VIN Digit 5 = 8 or 9)	2022	All	All	All

Involved Region or Country	North America
Condition	Some customers may comment that they are experiencing premature front brake pad wear. Typically, the brake pads may only last a few thousand miles after replacement.
Cause	The cause of this concern could be a change to the brake pad lining material starting mid year 2022, which is being used as the service replacement brake pads for all model years 2019 - 2024. Note: For later model years, that are not listed in this PI, please reference the latest version of bulletin 24-NA-073. This change was made to help with brake pad noise but has been found to prematurely wear out under certain driving condition where the brakes can get very hot, like during mountainous driving or heavy city/stop and go traffic.

Correction:

If after inspecting the brake system and no other faults are found causing premature brake pad wear, then replace the front brake pads with part number 84847749 which will provide improved pad life.

Parts Information

Description	Part Number	Qty
Front Brake Pad Kit	84847749	1

Version History

Version	8
Modified	03/15/2024 - Created on. 05/20/2024 - Update to the model years and Correction sections. 07/19/2024 - Update to the cause and correction sections. 09/12/2024 - Updated to change part number. 09/20/2024 - Updated to change part number and include ordering instructions. 11/12/2024 - Update to the correction section. 12/19/2024- Update to the Correction and Parts sections. 1/6/2025 - Updates to the Model and Cause sections.