



Bulletin No.: PIT6281A

Published date: 01/9/2025

Preliminary Information

PIT6281A SES MIL With ECM DTC P00FF and BCM DTC U1962

Models

Brand:	Model:	Model Years:	VIN: from	to	Engine:	Transmissions:
Cadillac	Escalade Models	2025	SOP	January 8, 2025	All	All
Chevrolet	Suburban	2025	SOP	January 8, 2025	All	All
Chevrolet	Tahoe	2025	SOP	January 8, 2025	All	All
GMC	Yukon Models	2025	SOP	January 8, 2025	All	All

Involved Region or Country	North America
Condition	A customer may experience a SES MIL and when scanning for DTCs there maybe a ECM P00FF and BCM U1962 set.
Cause	Under investigation

Correction:

Do not replace the Telematics Control Module or Body Control Module. Use GDS2 and perform a clear DTC's and retest. If the condition no longer exists, then no further repairs are needed. If the condition remains then use TLC/SPS and perform a Serial Data Authentication Configuration procedure, Document ID: 5404959.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
2888078*	Check for DTCs, Clear DTC's and retest.	0.3 Hrs.
Add Time	Perform Serial Data Authentication Configuration procedure	0.3 Hrs.


***This is a unique Labor Operation for Bulletin use only.**

Additional SI Keywords

U0499 U0485

Version History

Version	2
Modified	11/12/2024 - Created on. 01/09/2025 - Updated Models

 GM Global Brands

© 2025 General Motors. All Rights Reserved.