



Bulletin No.: PIT6218A
Published date: 01/13/2025

Preliminary Information

PIT6218A SES light P059F

Models

Brand:	Model:	Model Years:	VIN: from to	Engine:	Transmissions:
Buick	Enclave	2025	All	All	All
Chevrolet	Traverse (All New)	2024 - 2025	All	All	LK0
GMC	Acadia	2024 - 2025	All	All	All

Involved Region or Country	North America
Condition	SES light on with code P059F set for active grill shutter malfunction.
Cause	Possible bent hood support front bumper bracket.

Correction:

Before replacing the grill shutter inspect the bracket in front of it for being bent as shown below.



**If the bracket is bent, remove the bracket and command the shutter with GDS2.
If the shutter will move when commanded replace the bracket only.**

If the shutter does not move or does not move smoothly, replace the bracket and shutter.


See the photo below of a good bracket for comparison.



If the bracket is not bent follow SI diagnostics for the code.

Version History

Version	2
Modified	08/19/2024 - Created on. 01/13/2025- Updated model years.

 GM Global Brands

© 2025 General Motors. All Rights Reserved.