



Service Bulletin

Bulletin No.: 24-NA-273

Date: January, 2025

TECHNICAL

Subject: Malfunction Indicator Lamp (MIL) Illuminated - DTC U01BE Set

Brand:	Model:	Model Year:		Build Date:		Engine:	Transmission :
		from	to	from	to		
Chevrolet	Corvette E-Ray	2024	2025	—	—	RPO LT2	RPO MLH

Involved Region or Country	North America, Europe, Middle East, Iraq, Israel, Palestine, Japan, Philippines, Australia/New Zealand
Condition	Some customers may comment on the MIL illuminated. Technicians may find DTC U01BE (Lost Communication with Drive Motor Disconnect Clutch Actuator) set.
Cause	This condition may be caused by an internal microchip malfunction inside the M162 Drive Motor Disconnect Clutch Actuator on some units.
Correction	Replace the M162 Drive Motor Disconnect Clutch Actuator for this condition.

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Service Procedure

Refer to *Drive Motor Disconnect Clutch Actuator Replacement*.

Parts Information

Causal Part	Description	Part Number	Qty
X	ACTUATOR ASM-DRV MOT DISCONNECT CLU	24052771	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
8630460	Drive Motor Disconnect Clutch Actuator Replacement	Use Published Labor Operation Time

Version	1
Modified	Released January 07, 2025

