



## **SSM 53306 2020-2022 F-Super Duty - 6.7L - RWD - Service Transmission May Be Equipped With The Wrong Output Shaft Flange**

Some 2020-2022 F-Super Duty vehicles equipped with a 6.7L engine and rear wheel drive (RWD) may require replacement of the transmission assembly for various reasons. The replacement service transmission may have the incorrect output shaft flange installed if equipped with a flanged yoke. The output shaft flange will be wider, which will not allow installation of the rear driveshaft. To correct this condition, transfer the output shaft flange from the old transmission to the new service replacement transmission. Refer to the Workshop Manual (WSM), Section 307-01B > Removal and Installation > Output Shaft Seal – Vehicles With: Flanged Yoke.