

Problem Details:


- Western Star trucks were configured incorrectly
- City horn sounds when park brake is not set and door opened.
- Feature **NOT** requested by the customer or body builder **vehicle ordered with data code 275-998-NO EMERGENCY WARNING SIRENS**, yet received functionality provided with data code **275-061- PARK BRAKE REMINDER WARNING SYSTEM**

FSPRs, FRACAS, DPR, Zeus:

- Customer complaint (no FSPR)

Affected Models / Truck options:

- Maximum impacted population: 8,741 Vehicles
- All Western Star Trucks

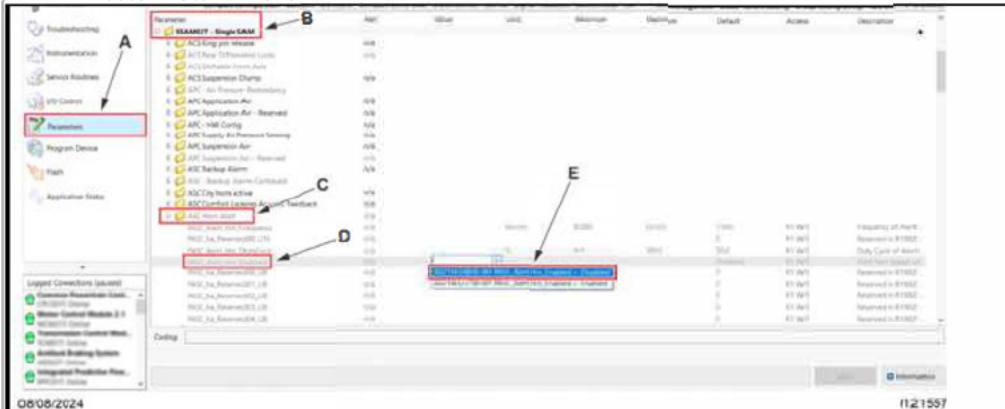

- A. Go to the 'Parameters' tab.
- B. Select and expand the 'SSAM02T - Single SAM' folder.
- C. Select the 'PASC_Alert_Hrn_Enabled' parameter.
- D. Select the 'PASC_Alert_Hrn_Enabled' parameter.
- E. Set the parameter value to 'A0214432858-001.'

Production Containment:

- Issue found in selection chart
- Maintenance release P22CAB-M1 addressed the charting problem

No Yes

Field Containment (short term):

- Fix as fail

No Yes

Root Cause:

- Engineering error with selection chart
- 275-998 needs to be charted differently from other options

No Yes

Long Term Corrective Action Plan:


- N/A – handled with maintenance release

No Yes

Long Term Field Plan:

- Service Bulletin

No Yes

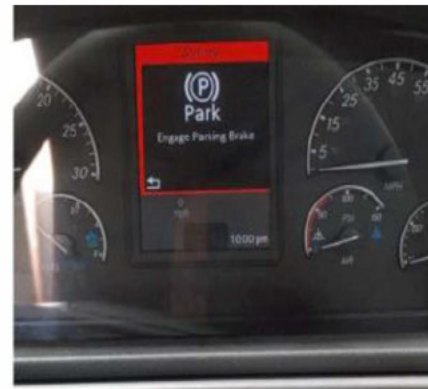

Q-Meeting