

## GPOP - Issue Review System

**Part Number:** 68156061A\$

**Part Description:** SWITCH Headlamp

---

**Issue Description:** Before replacing the Headlamp Switch for faulty dimmer operation. Please follow the next steps to corroborate if the Headlamp Switch is malfunctioning:

- 1.- Please disconnect and reconnect the headlamp Switch. And verify if the issue is corrected.
- 2.- Review the internal resistance of the switch:
  - a.- For the Right Dimmer (IP) between Pins 6 & 3. The value should be around 5.74 KOhms, when in the lowest position to 311 ohms in the top position (Parade Detent).
  - b.- For the left Dimmer (Ambient Light) between pins 8 & 3. The value should be around 14.52 KOhms, when in the lowest position to 182 ohms in the top position. If a problem is found in the resistor values. Please replace the Switch.