


RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network

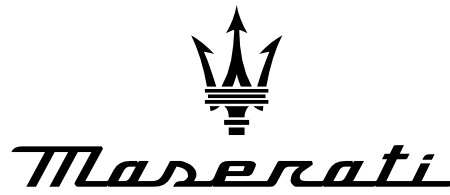

PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 776

MC20 RHT – LSMD/LSMP Software Updates



DATE: January 29, 2025

Certain Maserati MC20 Cielo (M240) MY23 MY24 MY25 listed in MODISCS+ are involved in a Rapid Update concerning the LSMD (Latch Smart Module Driver) and LSMP (Latch Smart Module Passenger) software updates.

This update is needed to avoid a potential incorrect movement of the windows during the door opening phase. As a consequence, in the very few cases where the short drop failure happened, a deformation or damage of the molding on the A-pillar took place.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before ordering parts and/or starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions.

Thank You for your continued support and cooperation.

Maserati North America
Aftersales Dept.

Technical Procedure

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Before proceeding, please ensure that the Engine is OFF.
3. Connect a battery maintainer to the 12V battery (It is recommended to always use the E-XTEQ MAXIMUS to maintain minimum voltage and current draw requirements)
4. Connect the EVO to the vehicle, ensure that battery voltage is around 12.5V then select **LSMD** ► **ECU Programming** and follow the prompts.

Software version to be installed (or newer).

Drive	F188 New
Left Hand	670354888
Right Hand	670354889

5. With MD-EVO perform **LSMP – ECU Programming**.

Software version to be installed (or newer).

Drive	F188 New
Left Hand	670354892
Right Hand	670354893

1. With MD-EVO perform **BCM – Procedures – PROXI Alignment**.
2. Using MD-EVO, clear DTCs.
3. The operation is completed.

Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Rapid Update Number	776
Warranty Code	23
Fault Code	063
Component Code	9.31.007
Operation Code	
LSMD SW Update	9.31.007.A (0,20h)
LSMP SW Update	9.31.008.A (0,20h)