



Bulletin No.: PIP6039
Published date: 01/22/2025

Preliminary Information

PIP6039 Information on Malfunction Indicator Lamp (MIL) Illuminated - DTC P10BA

Models

Brand: Model: Model Years: VIN: **from to** **Engine: Transmissions:**
Cadillac CT5-V 2025 All All 6.2L LT4 All

| | |
|-----------------------------------|---|
| Involved Region or Country | North America |
| Condition | <p>Some customers may comment that the check engine light was on or is illuminated.</p> <p>Upon inspection technician may find DTC P10BA (Charge Air Cooler Coolant Pump Speed Performance) active or stored in history.</p> <p>Customer may also experience reduced engine power.</p> <p>This condition is more likely to occur at ambient temperatures below 25 degrees Fahrenheit.</p> |
| Cause | GM has discovered that the P10BA diagnostic is vulnerable to false failure when manifold temperature persists around 40°F. |

Correction:

At this time, it will be necessary to clear the code and release vehicle back to the customer.

Do not attempt to replace any parts for this condition.

GM engineering is working on a calibration update to correct the condition but is not currently available.

Bulletin will be updated with applicable information once calibration is released.

Version History

| | |
|-----------------|--------------------------|
| Version | 1 |
| Modified | 01/22/2025 - Created on. |



© 2025 General Motors. All Rights Reserved.