

<b>REFERENCE:</b>	<b>TSB:</b> 14-002-25 REV. A <b>GROUP:</b> 14 - Fuel	<b>Date:</b>	February 1, 2025	<b>REVISION:</b>	14-002-25
<b>VEHICLES AFFECTED:</b>	<b>2024 - 2025 (B1) Jeep Renegade</b> <b>2024 - 2025 (H1) Jeep Commander</b> <b>2024 - 2025 (M1) Jeep Compass</b> <b>2024 - 2025 (N4) RAM Rampage</b> This bulletin applies to the vehicle built on or after <b>**January 08, 2024 (MDH 0108XX)**</b> and on or before <b>December 13, 2024 (MDH 1213XX)</b> .			<b>MARKET APPLICABILITY:</b>	
				<input checked="" type="checkbox"/> NA	<input type="checkbox"/> MEA
				<input checked="" type="checkbox"/> SA	<input type="checkbox"/> IAP
				<input type="checkbox"/> EE	<input type="checkbox"/> CH
<b>CUSTOMER SYMPTOM:</b>	<b>Customers may comment on the following:</b> <ul style="list-style-type: none"> <li>• Difficult to refuel the vehicle.</li> </ul>				
<b>CAUSE:</b>	Loose quick connect fittings				

This bulletin supersedes Technical Service Bulletin (TSB) 14-002-25, date of issue January 28, 2025, which should be removed from your files. All revisions are highlighted with **\*\*asterisks\*\*** and include a build date correction with the VIN list.

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 25-012, date of issue January 28, 2025. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/ Service Library. All repairs are reimbursable within the provisions of warranty.

**NOTE:** NA market applicability applies to Mexico only.

**CLAIMS DATA:**

Labor Operation No:	Labor Description	Skill Category	Labor Time
14-70-10-9B	Fuel Hose - Inspection (0 - Introduction)	1 - Engine Repair and Performance	0.2 Hrs.
14-70-10-9C	Fuel Hose - Inspect and Repair (0 - Introduction)	1 - Engine Repair and Performance	0.2 Hrs.
Failure Code	ZZ	Service Action	

**REPAIR SUMMARY:**

This bulletin involves inspecting, and if necessary, properly connecting the fuel hose quick connects.

**DIAGNOSIS:**

If a customer's VIN is listed in VIP or your RSU VIN list, perform the repair. If any vehicle not on the VIN list exhibits any of the symptom listed above in the customer symptom section, perform the Repair Procedure.

**REPAIR PROCEDURE:**

1. Raise the rear seat cushion [Fig. 1](#).



**Fig. 1**  
Rear Seat Cushion

1 - Raise Rear Seat Cushion

2. Remove the three screws securing the fuel pump access cover [Fig. 2](#).

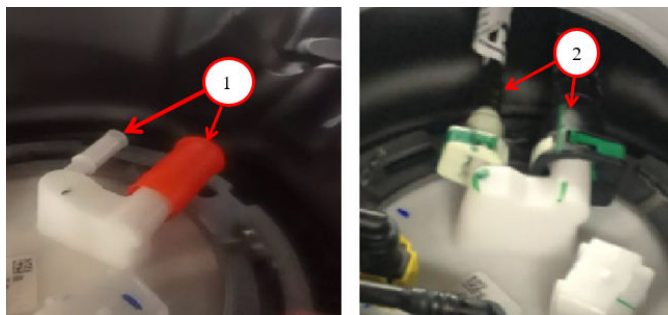


**Fig. 2**  
Fuel Pump Access Cover Screws

1 - Screws

2 - Fuel Pump Access Cover

3. Inspect the fuel breather tube connections to the fuel pump [Fig. 3](#).



**Fig. 3**  
Fuel Pump Breather Tubes

1 - Fuel Breather Tubes Disconnected  
2 - Fuel Breather Tubes Connected

4. Are the fuel breather tubes connected to the fuel pump [Fig. 3](#)?

- YES>>> This bulletin has been completed. Use Inspection LOP (14-70-10-9B) to close the active RSU and proceed to [Step 6](#).
- NO>>> Proceed to [Step 5](#).

5. Remove the red tamper proof cover and connect the fuel breather tubes to the fuel pump [Fig. 3](#).

6. Lower down the rear seat cushion to its installed position and engage both seat cushion locks [Fig. 4](#).



**Fig. 4**  
Rear Seat Cushion Locks

1 - Rear Seat Cushion Lock

**POLICY:**

Reimbursable within the provisions of the warranty.

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*